



















### Map Grid Index

## LEGEND:

	Monitoring Well		Approximate Limit of Saturated Alluvium Upper Aquifer (Dashed Where Inferred)
	Domestic Supply Well (active and inactive)		Approximate Location of Lockhart Fault; Fault Trace is Inferred, and There is No Surface Expression (Stamos et al. 2001)
	Other Supply Well		Approximate Outline of Cr(VI) or Cr(T) in Upper Aquifer Exceeding Values of 3.1 and 3.2 µg/L, Respectively, Fourth Quarter 2018 (Dashed Where Inferred)
	Groundwater Extraction Well		Approximate 10 µg/L Outline of Cr(VI) or Cr(T) Concentrations in Upper Aquifer, Fourth Quarter 2018 (Dashed Where Inferred)
	Multiuse Test Well, or Inactive Extraction/Injection Well		Approximate 50 µg/L Outline of Cr(T) Concentrations in Upper Aquifer, Fourth Quarter 2018
	Inactive In Situ Reactive Zone Injection Well		Approximate 1,000 µg/L Outline of Cr(VI) or Cr(T) Concentrations in Upper Aquifer, Fourth Quarter 2018
	Freshwater Injection Well		
	PG&E-Owned Property		
	PG&E Compressor Station		
	County Parcel		
	Bedrock Exposed at Ground Surface		
	See Footnote 3.		

## SA-SM-01S Well ID

150/160 Cr(VI)/Cr(T) concentrations in µg/L; maximum of primary and duplicate samples during Fourth Quarter 2018 sampling.  
(500/480) Data in parentheses are from previous reporting period. See Table E-1 for sample dates.


DRY Groundwater monitoring program well that has been dry for at least a year

+ Location is Approximate, Survey Pending

## ABBREVIATIONS:

µg/L	Micrograms per Liter
CAO	Cleanup and Abatement Order
Cr(VI)	Hexavalent Chromium
Cr(T)	Total Dissolved Chromium
J	Estimated Result
ND	Not Detected
NS	Not Sampled

## Groundwater Cr(VI) Concentrations in Monitoring Wells:

	More than 1,000 µg/L		10 to 50 µg/L
	100 to 1,000 µg/L		3.1 to 10 µg/L
	50 to 100 µg/L		Less than 3.1 µg/L or ND

## NOTES:


- Chromium results are shown for Site-wide Groundwater Monitoring Program and domestic wells sampled in the Fourth Quarter (October through December) 2018 monitoring period. For wells sampled multiple times during the reporting period, the most recent results are shown.
- The concentration contours are based on Fourth Quarter 2018 chromium results for the groundwater monitoring and extraction wells that are completed in the shallow zone and deep zone of the Upper Aquifer as noted on Figures 5-1 and 5-2. Results for domestic wells (brown-colored labels) were not used for chromium plume contouring, except for those in the northern disputed plume areas, pursuant to the Lahonton Regional Water Quality Control Board's Cleanup and Abatement Order dated November 4, 2015 (Water Board 2015).
- Pursuant to the Lahonton Regional Water Quality Control Board's Cleanup and Abatement Order dated November 4, 2015 (Water Board 2015), groundwater monitoring wells are not used for chromium contouring if they are located in the areas southwest of the Lockhart Fault and on or east of Dixie Road. Monitoring wells sampled southwest of Lockhart Fault and east of Dixie Road were sampled in support of United States Geological Survey background chromium investigations.
- Chromium plume contours in the general area south of Highway 58, were developed using a larger set of monitoring data which is presented in the the Fourth Quarter 2018 Monitoring Report for the In Situ Reactive Zone and Northwest Freshwater Injection Projects (Arcadis 2019). Select wells from that program are shown here for reference.
- Chromium contours were changed on the eastern side of the plume during the Third Quarter of 2016. These changes were made based on discussions with the Water Board, requirements in the Order and professional judgement. These changes to the plume contours on the eastern side of the plume reflect a revised interpretation of monitoring data and do not indicate plume expansion.

## WORKS CITED:


Arcadis. 2019. Fourth Quarter 2018 Monitoring Report for the In Situ Reactive Zone and Northwest Freshwater Injection Projects, Pacific Gas and Electric Company, Hinkley Compressor Station, Hinkley, California, California Regional Water Quality Control Board, Lahontan Region Order No. R6V-2008-0014 (Waste Discharge Requirements Identification No. 6B369107001). January 30.

Stamos, C.L., P. Martin, T. Nishikawa, and B.F. Cox. 2001. *Simulation of Ground-Water Flow in the Mojave River Basin, California*. U.S. Geological Survey Water-Resources Investigations Report 01-4002, Version 3. Prepared in cooperation with the Mojave Water Agency.


Water Board. 2015. Cleanup and Abatement Order No. R6V-2015-0068 Requiring Pacific Gas and Electric Company to Cleanup and Abate Waste Discharges of Total and Hexavalent Chromium to the Groundwaters of the Mojave Hydrologic Unit. November 4.

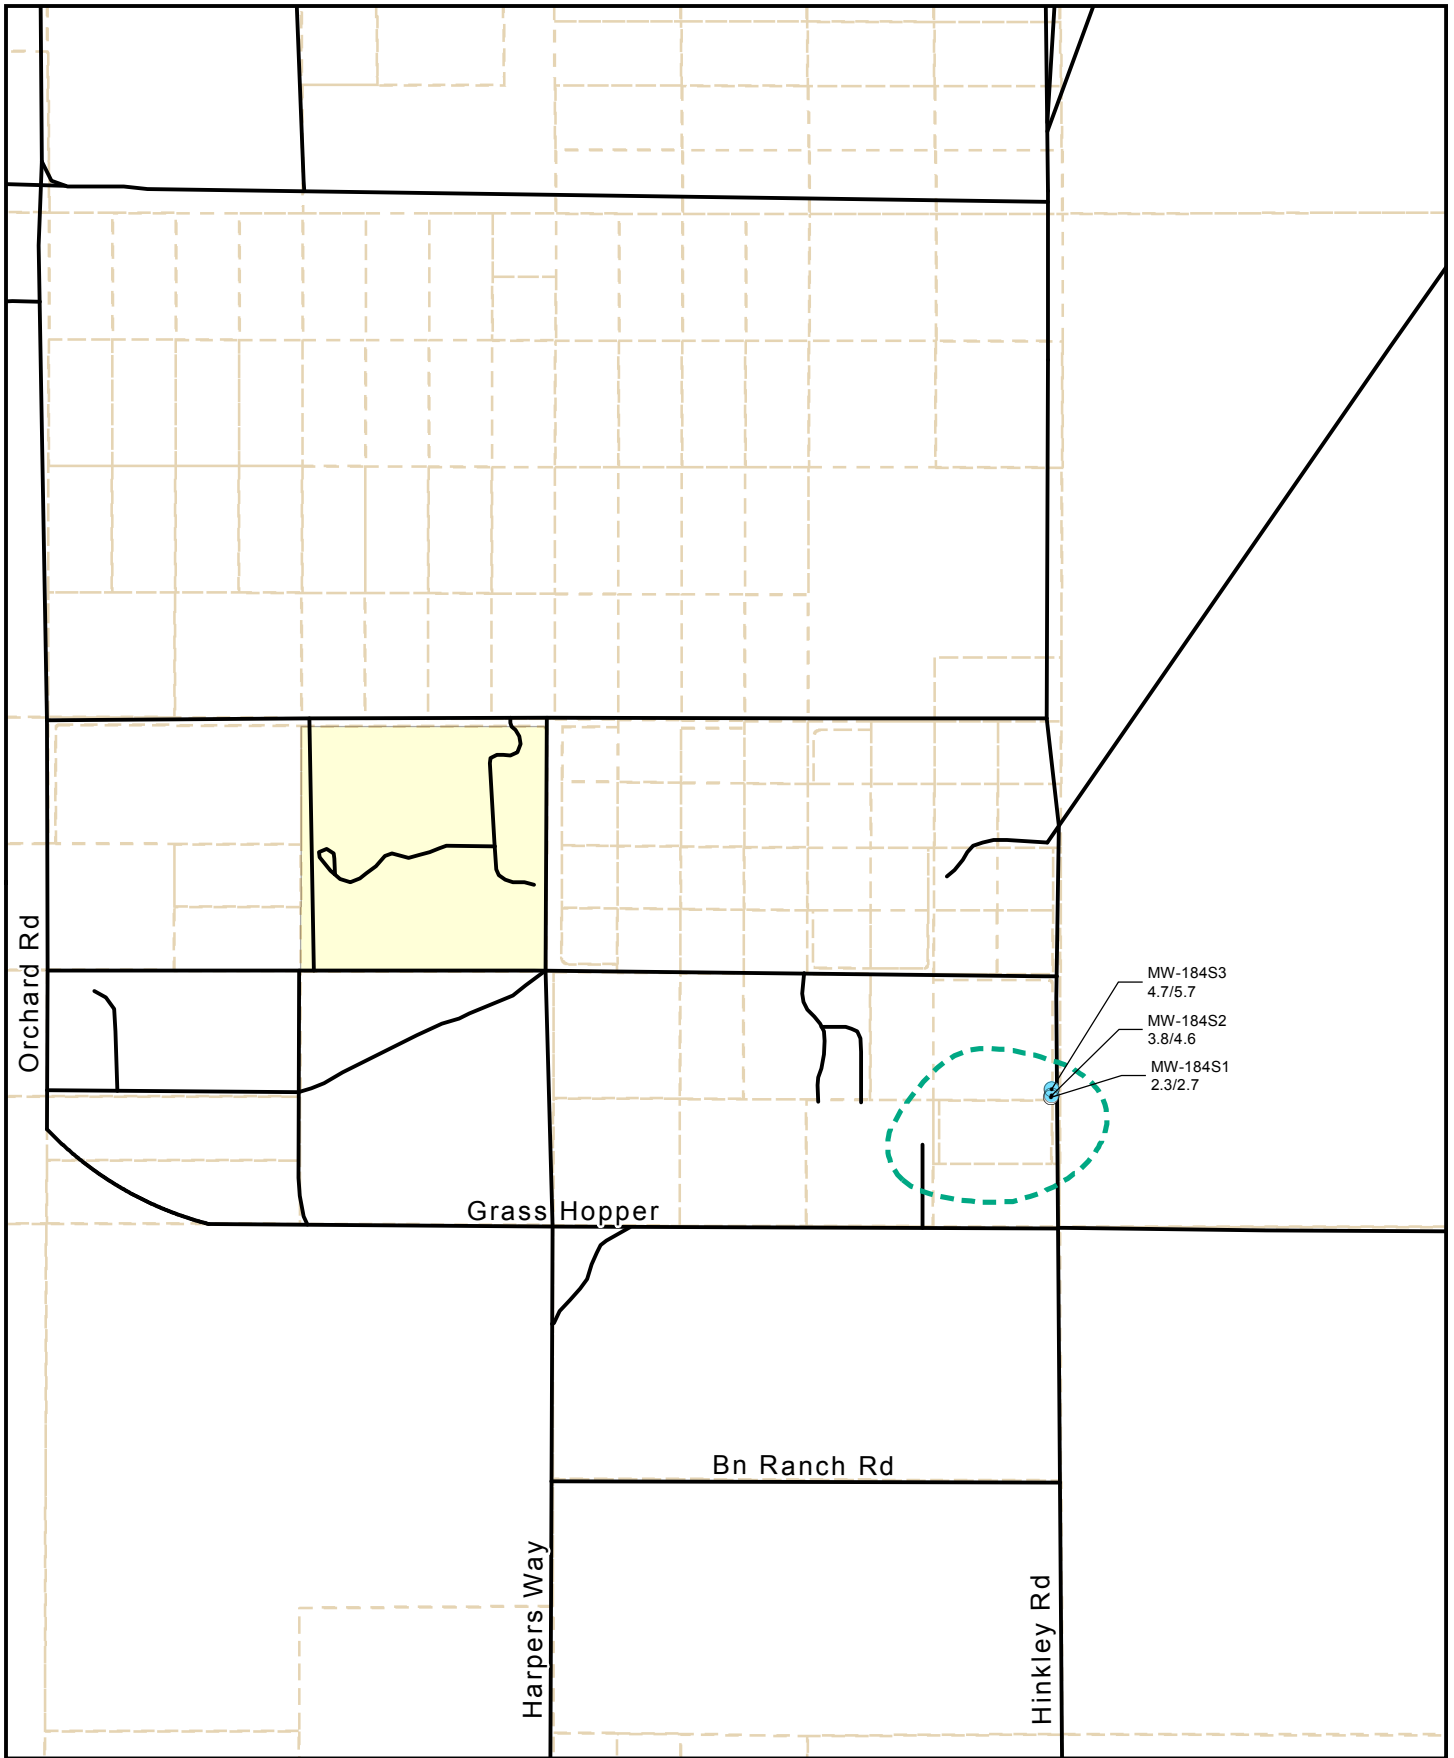


See Legend Figure for  
Feature Descriptions




MAP 01

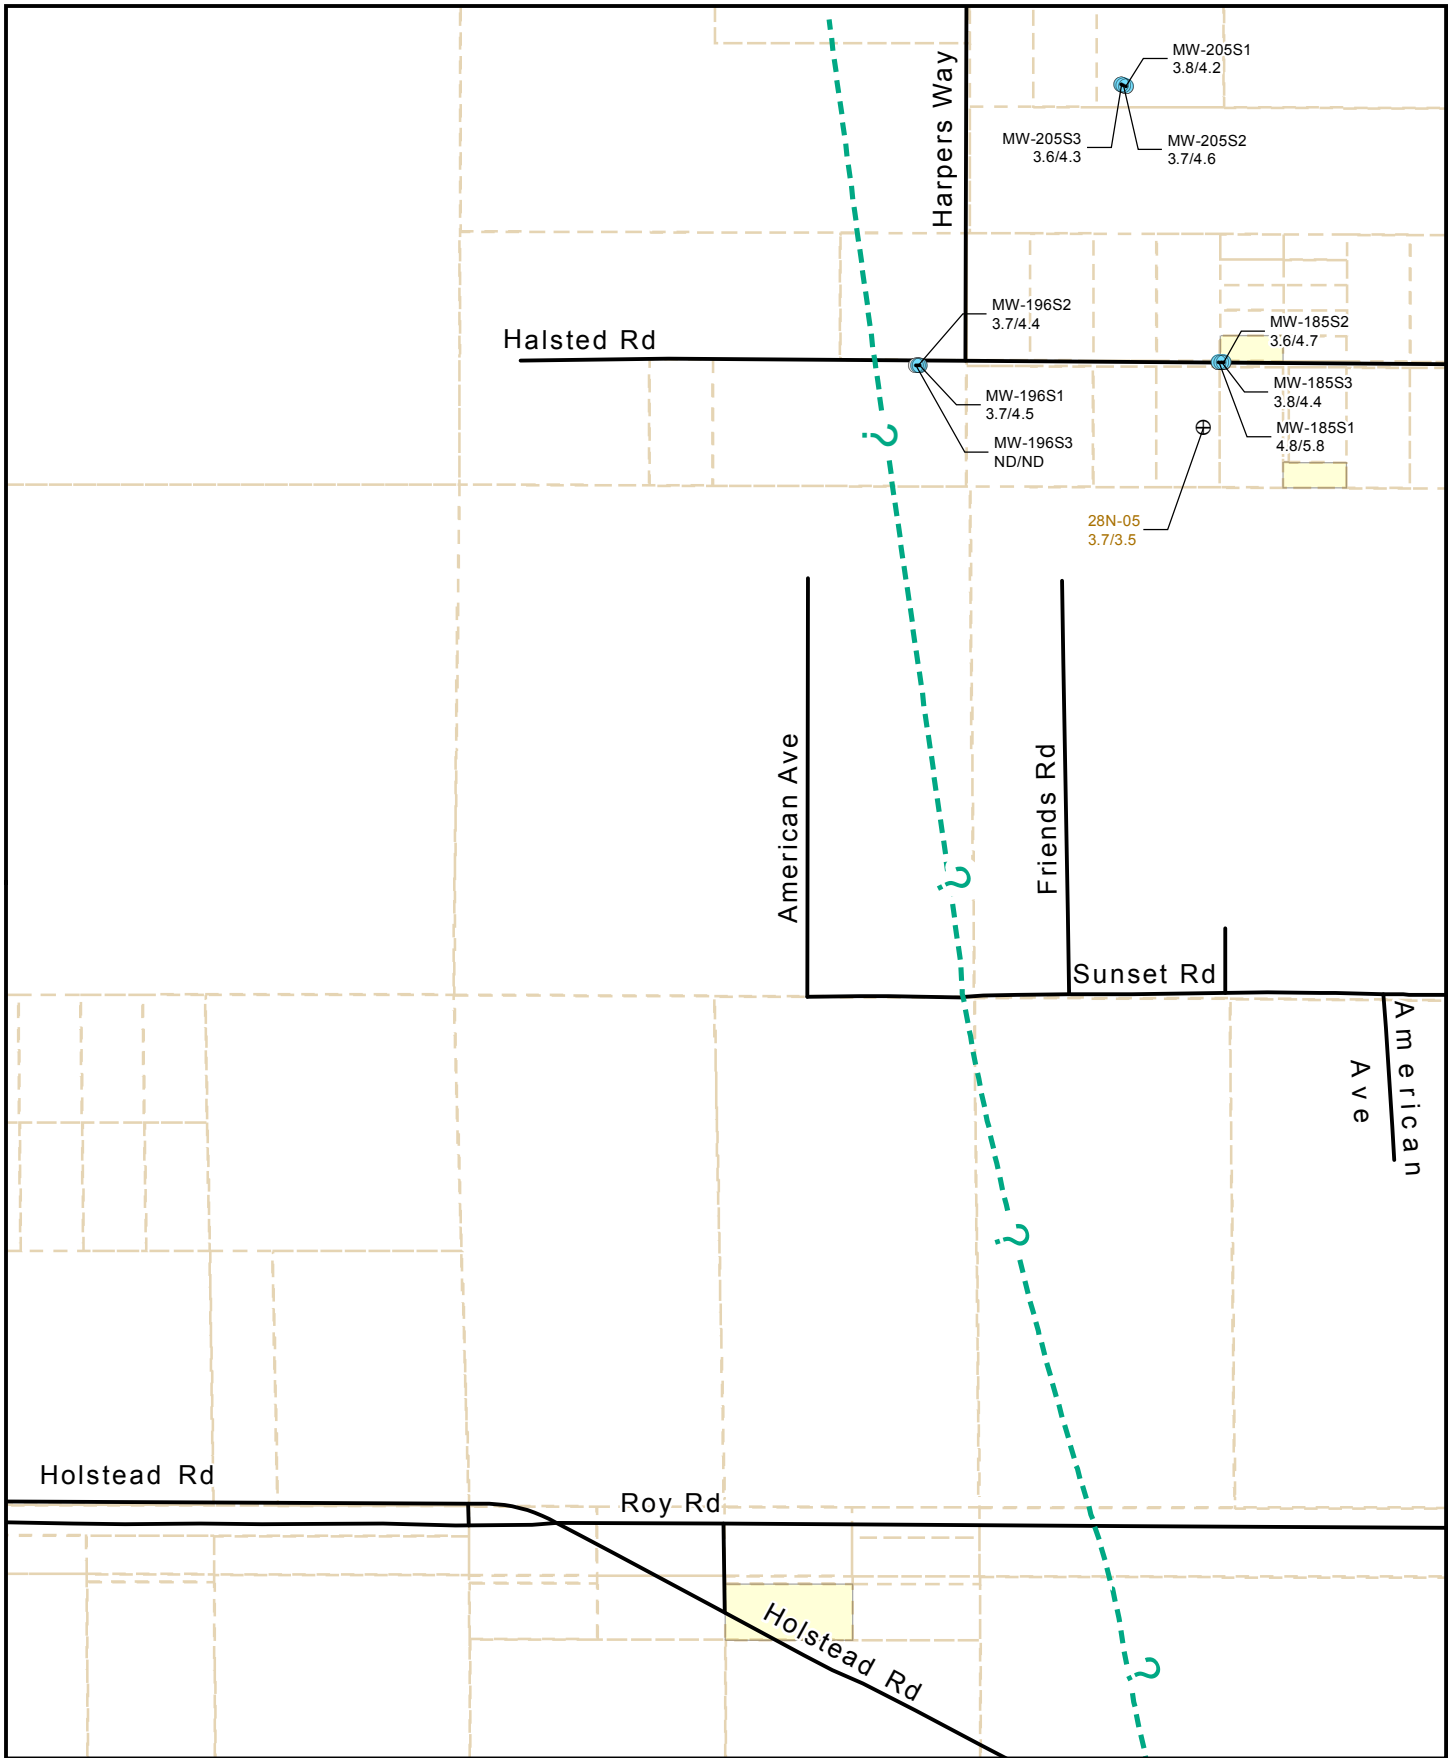


See Legend Figure for  
Feature Descriptions




MAP 02

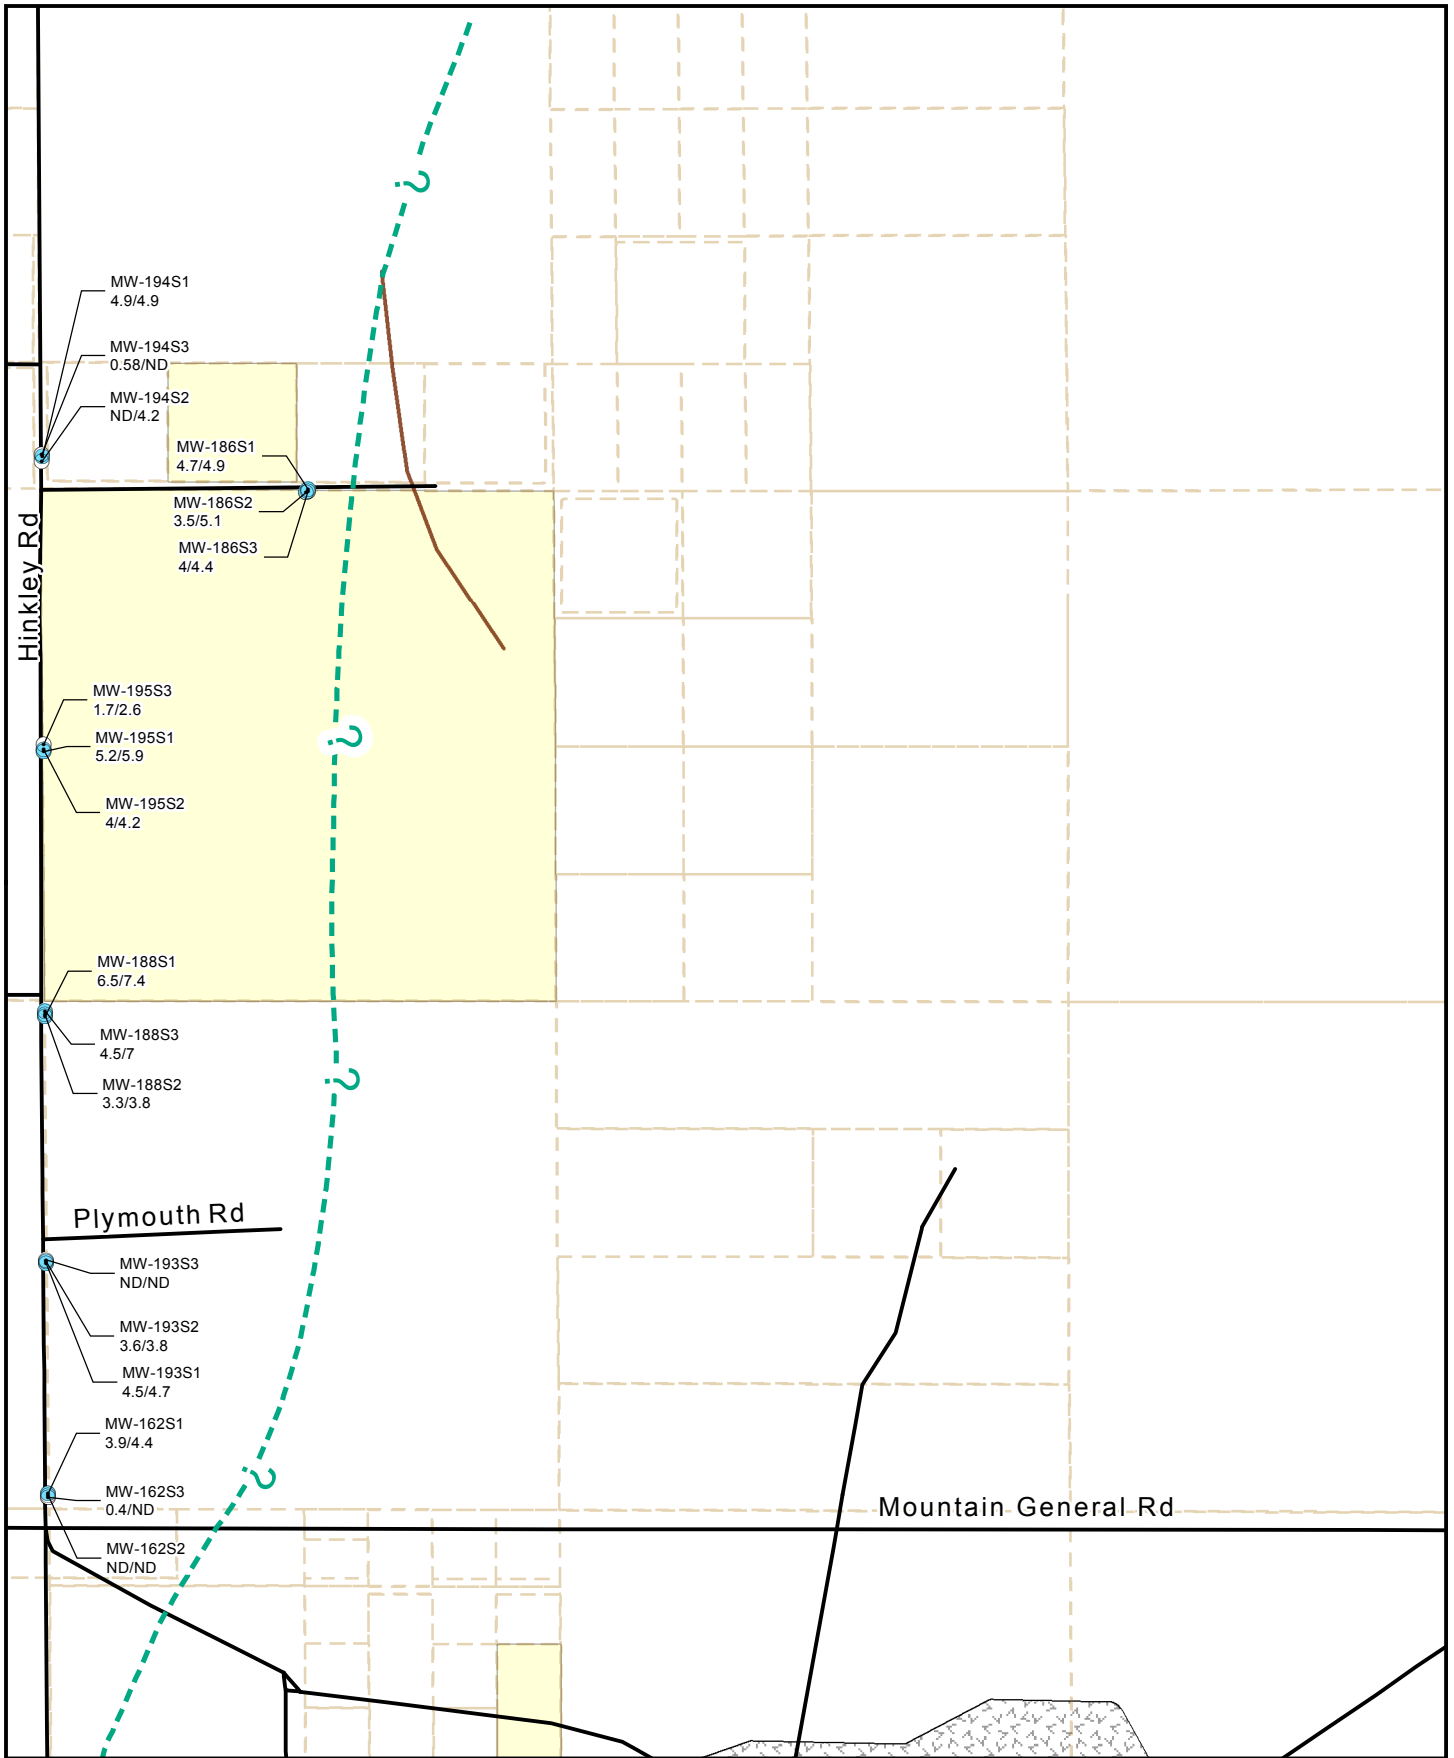


See Legend Figure for  
Feature Descriptions




MAP 03

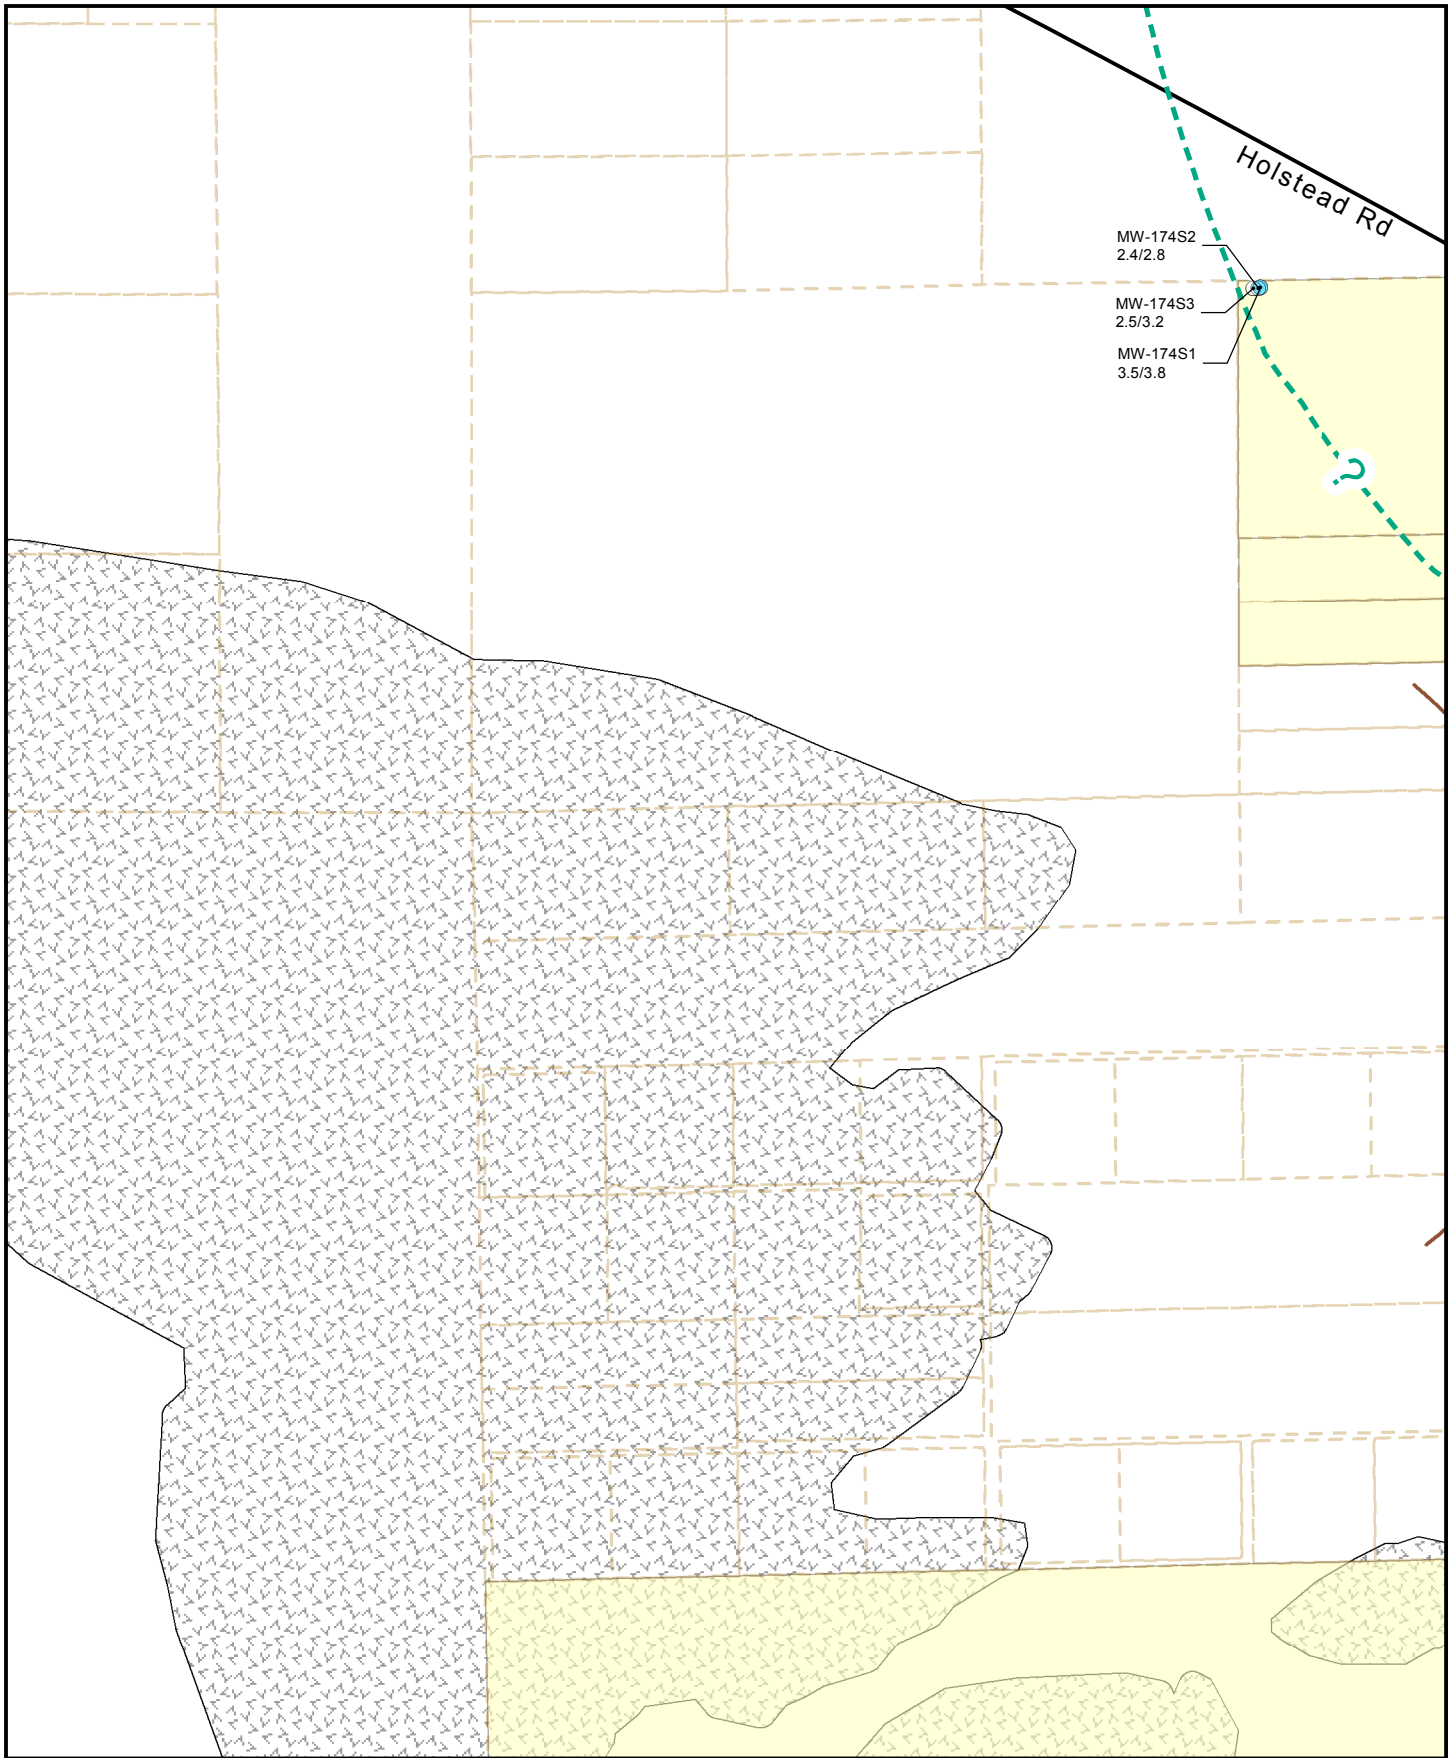


See Legend Figure for  
Feature Descriptions



MAP 04

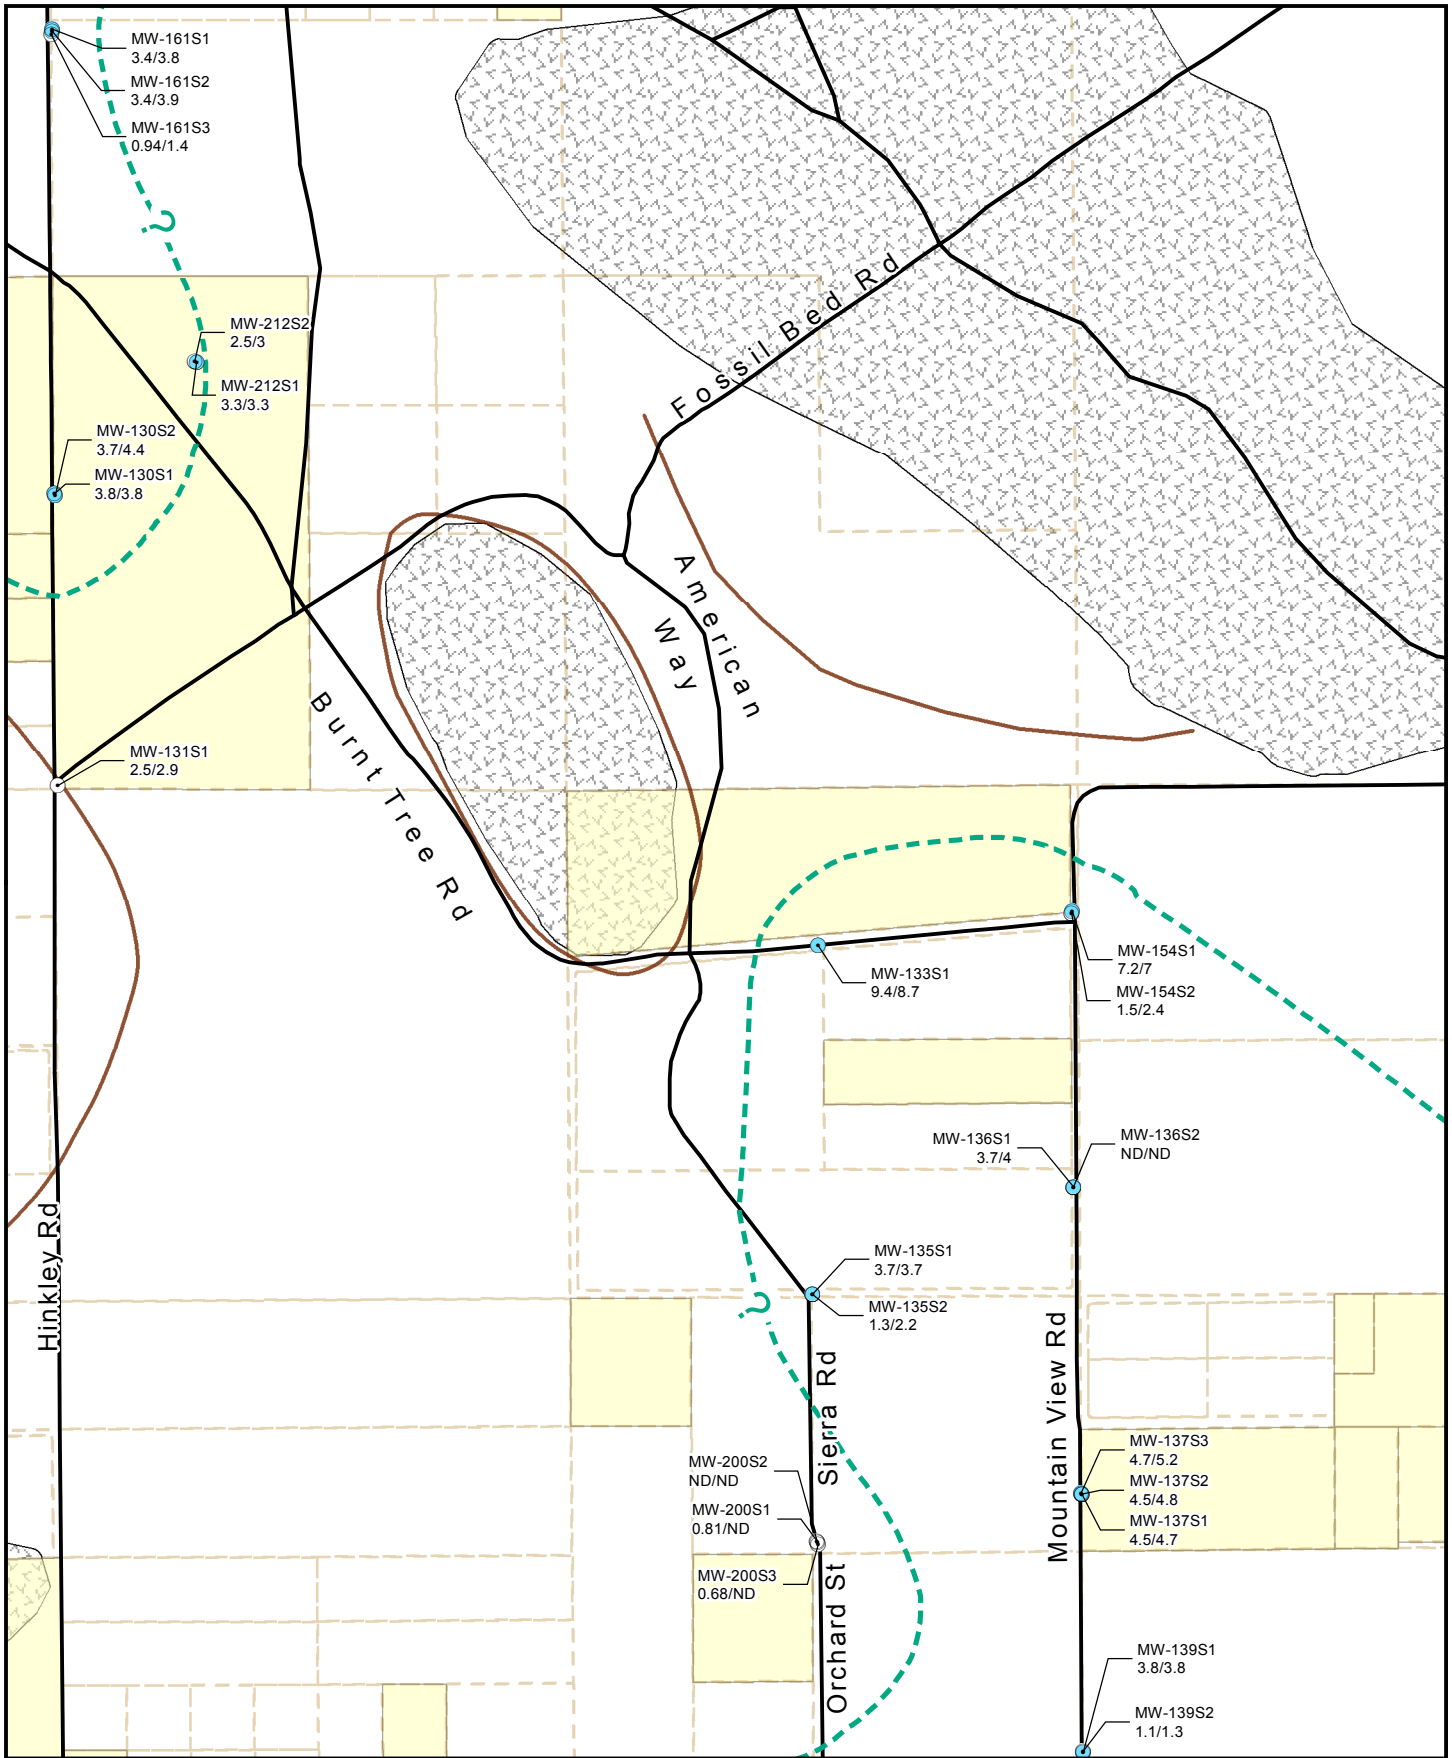


See Legend Figure for  
Feature Descriptions




MAP 05



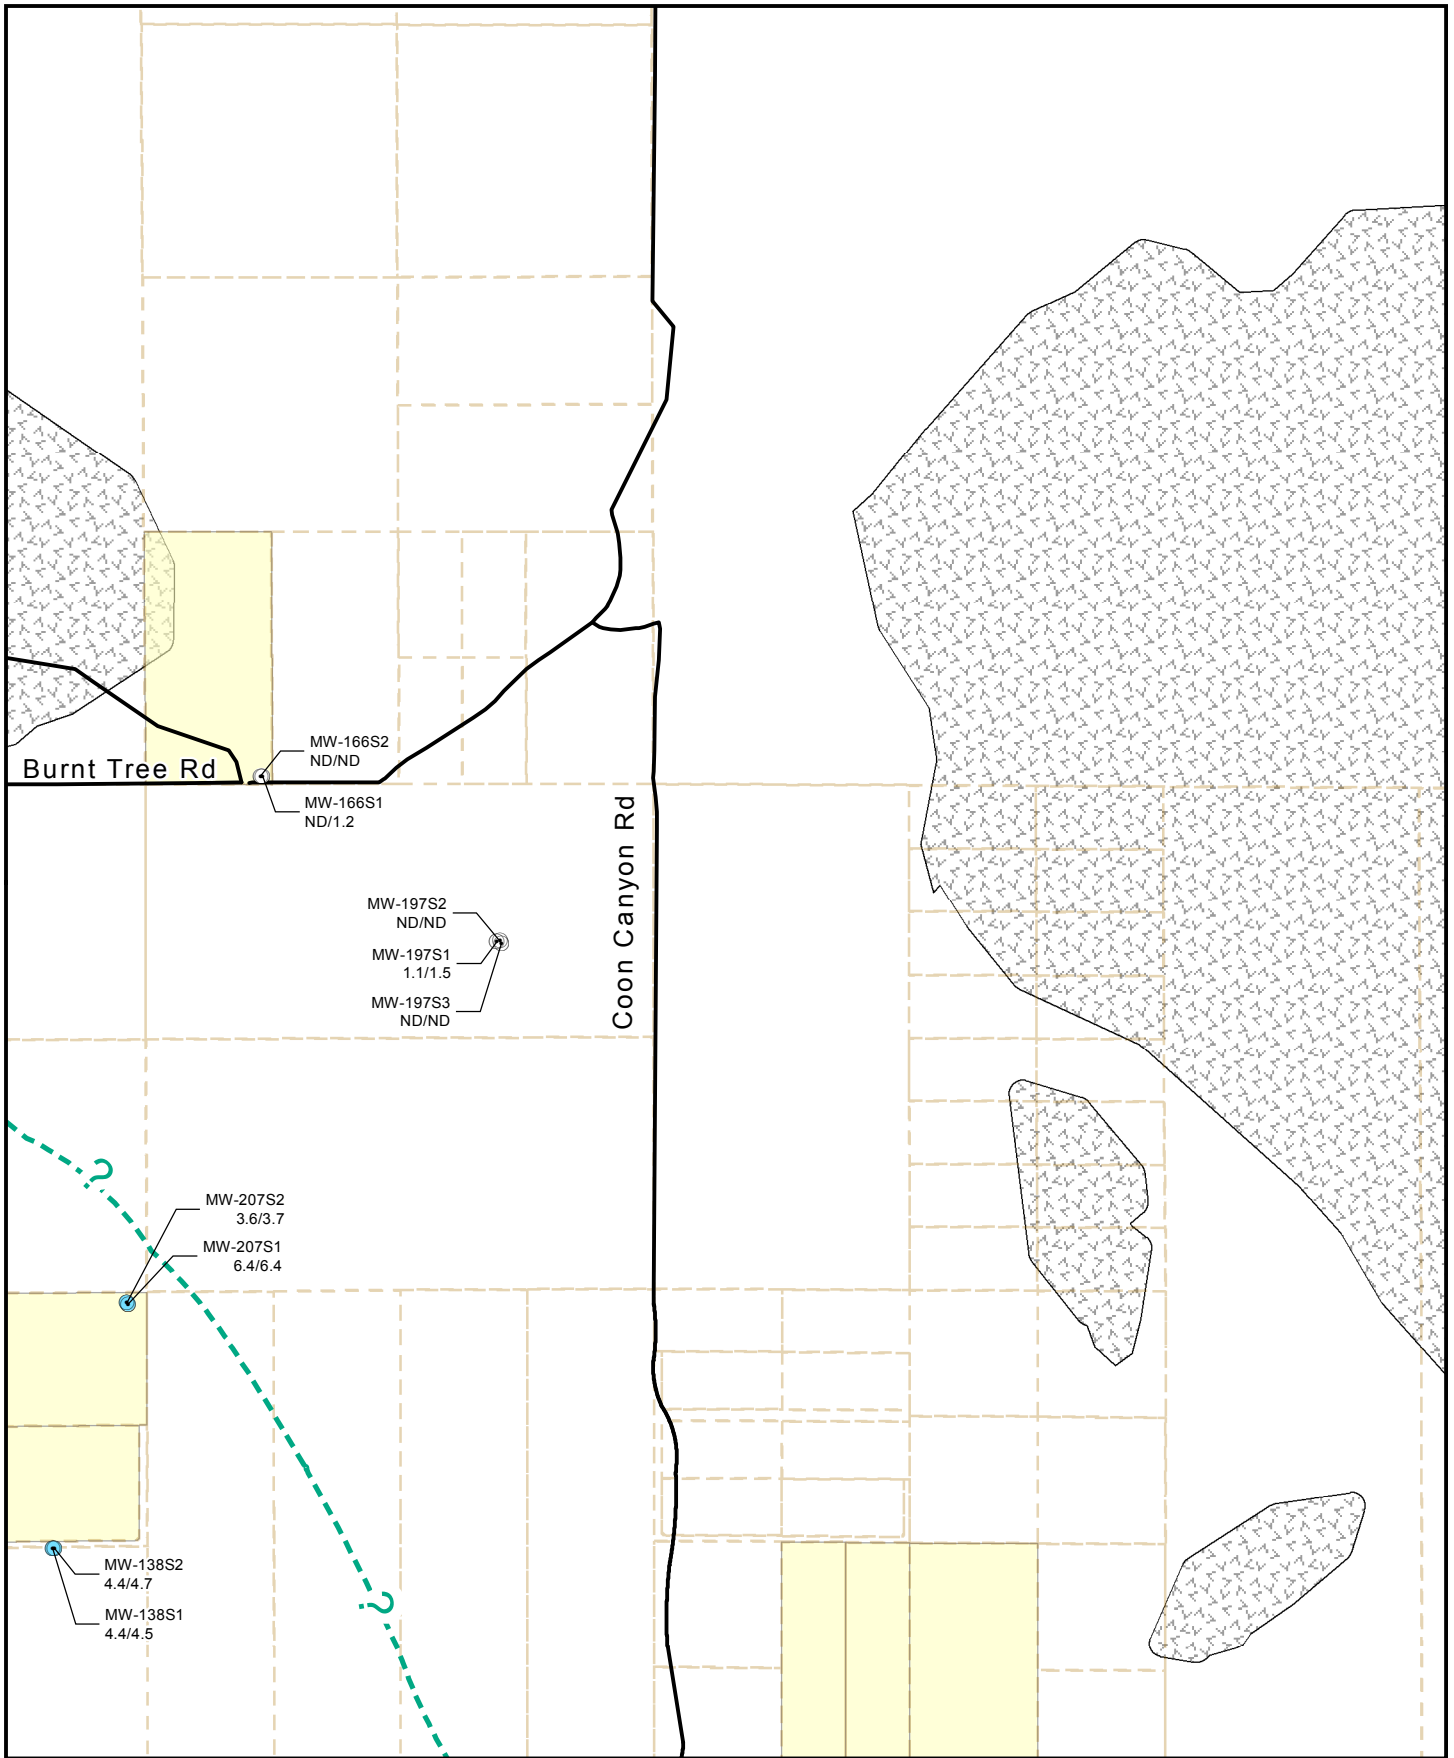


See Legend Figure for  
Feature Descriptions




MAP 06




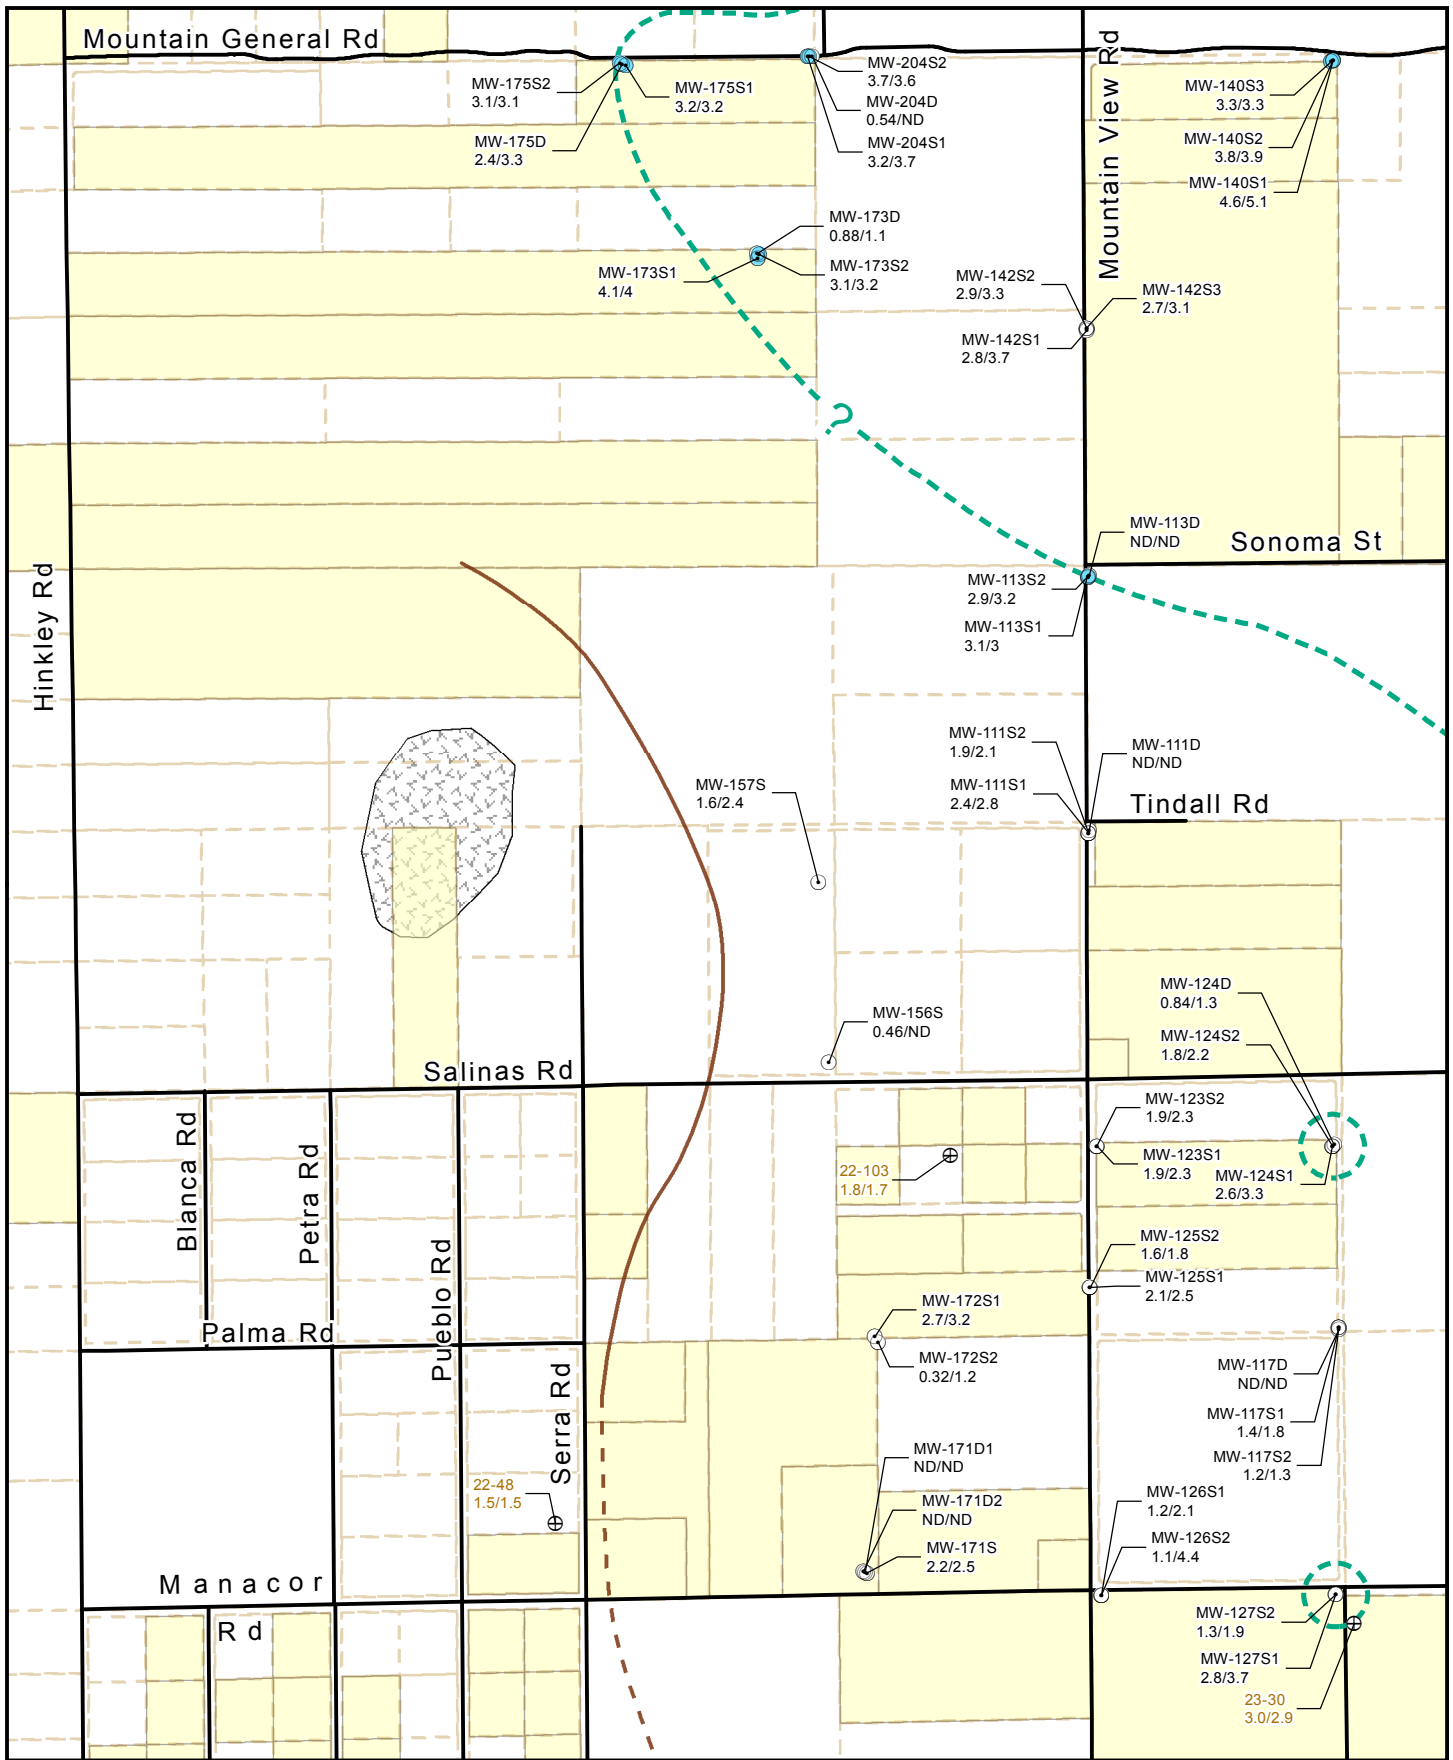


See Legend Figure for  
Feature Descriptions




**MAP 07**

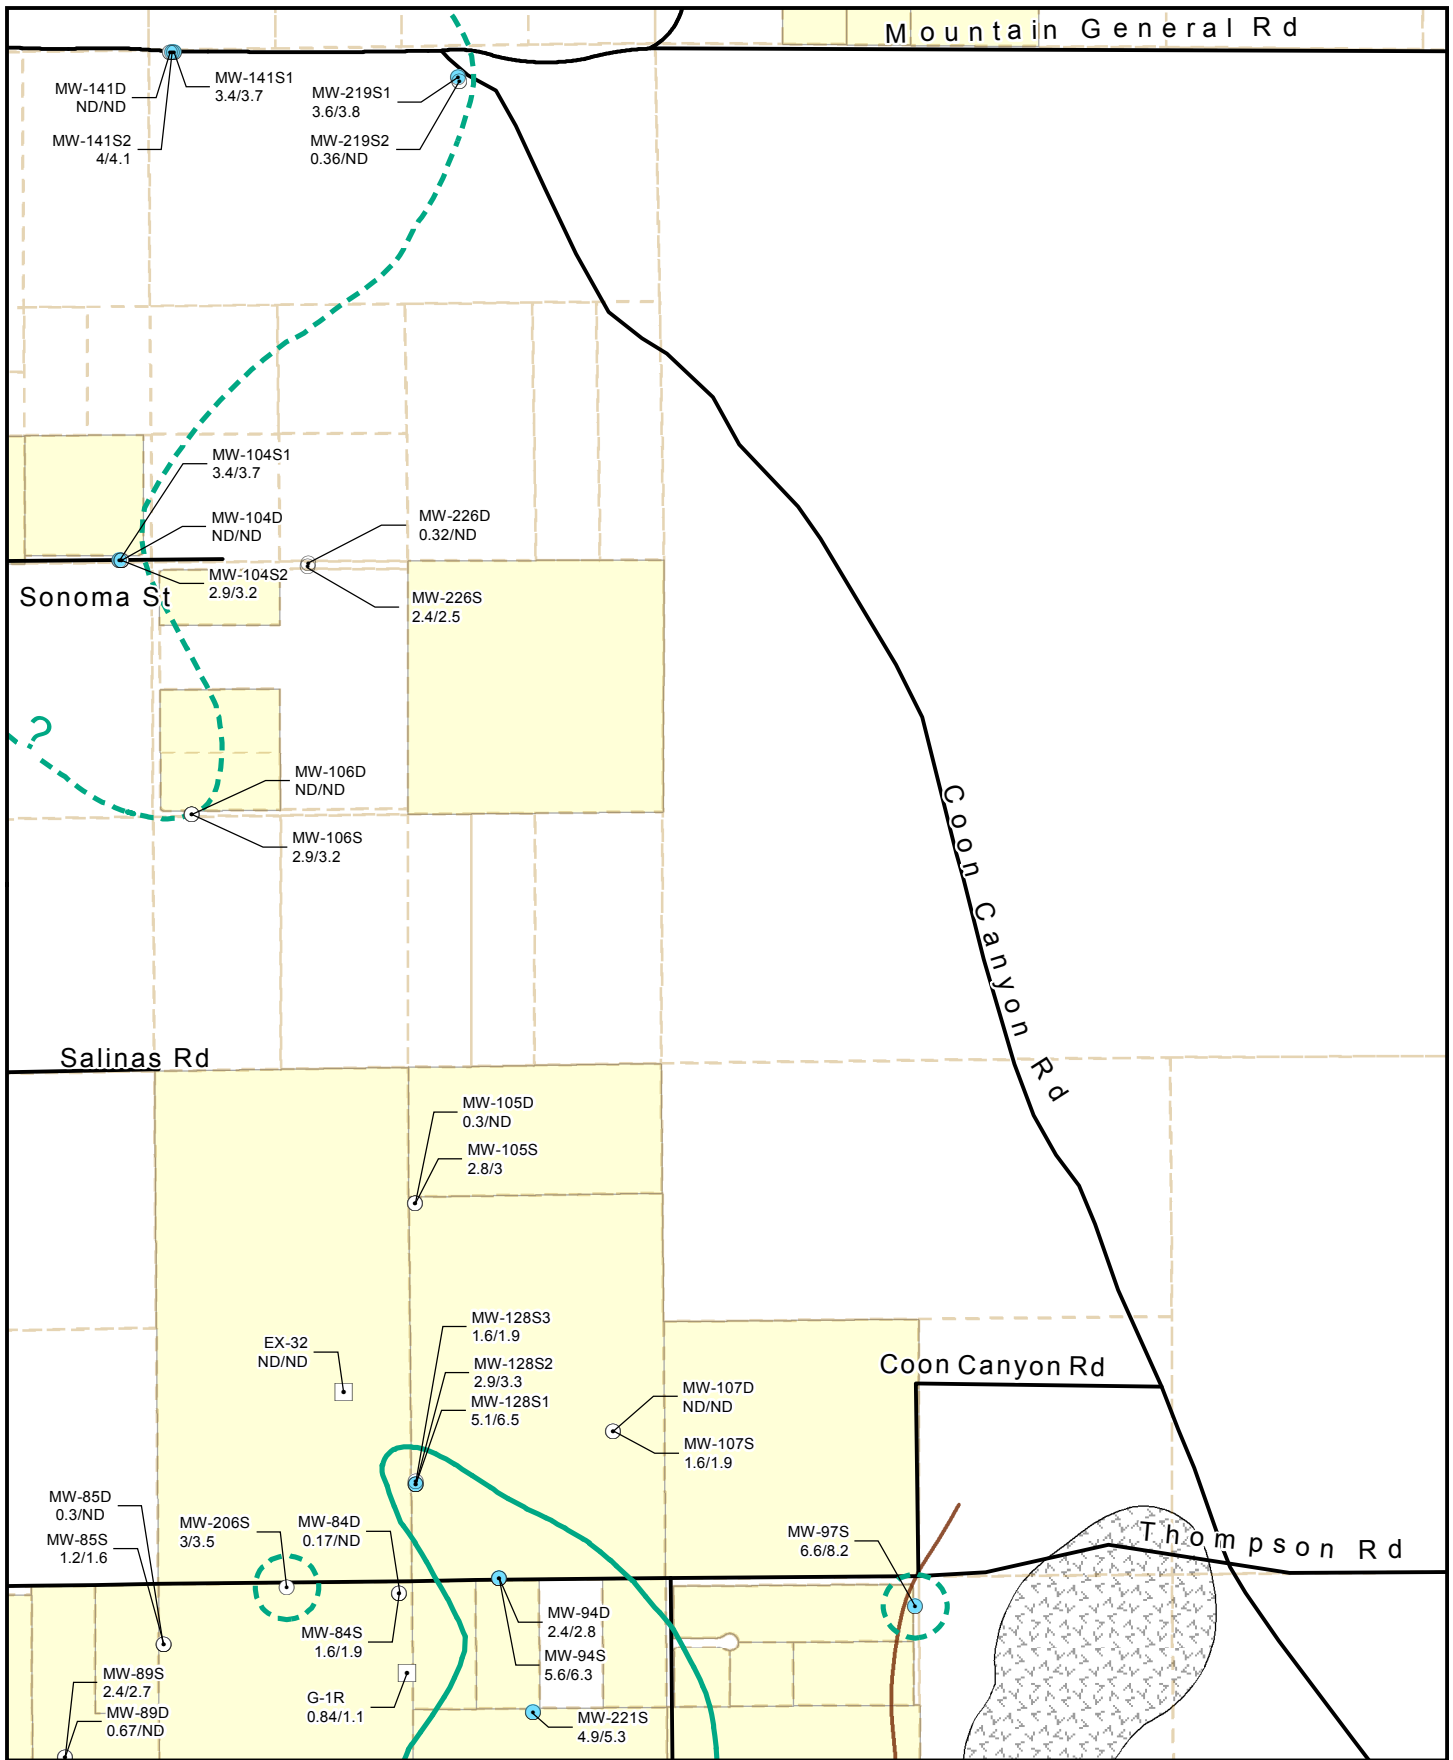

See Legend Figure for  
Feature Descriptions




**MAP 08**

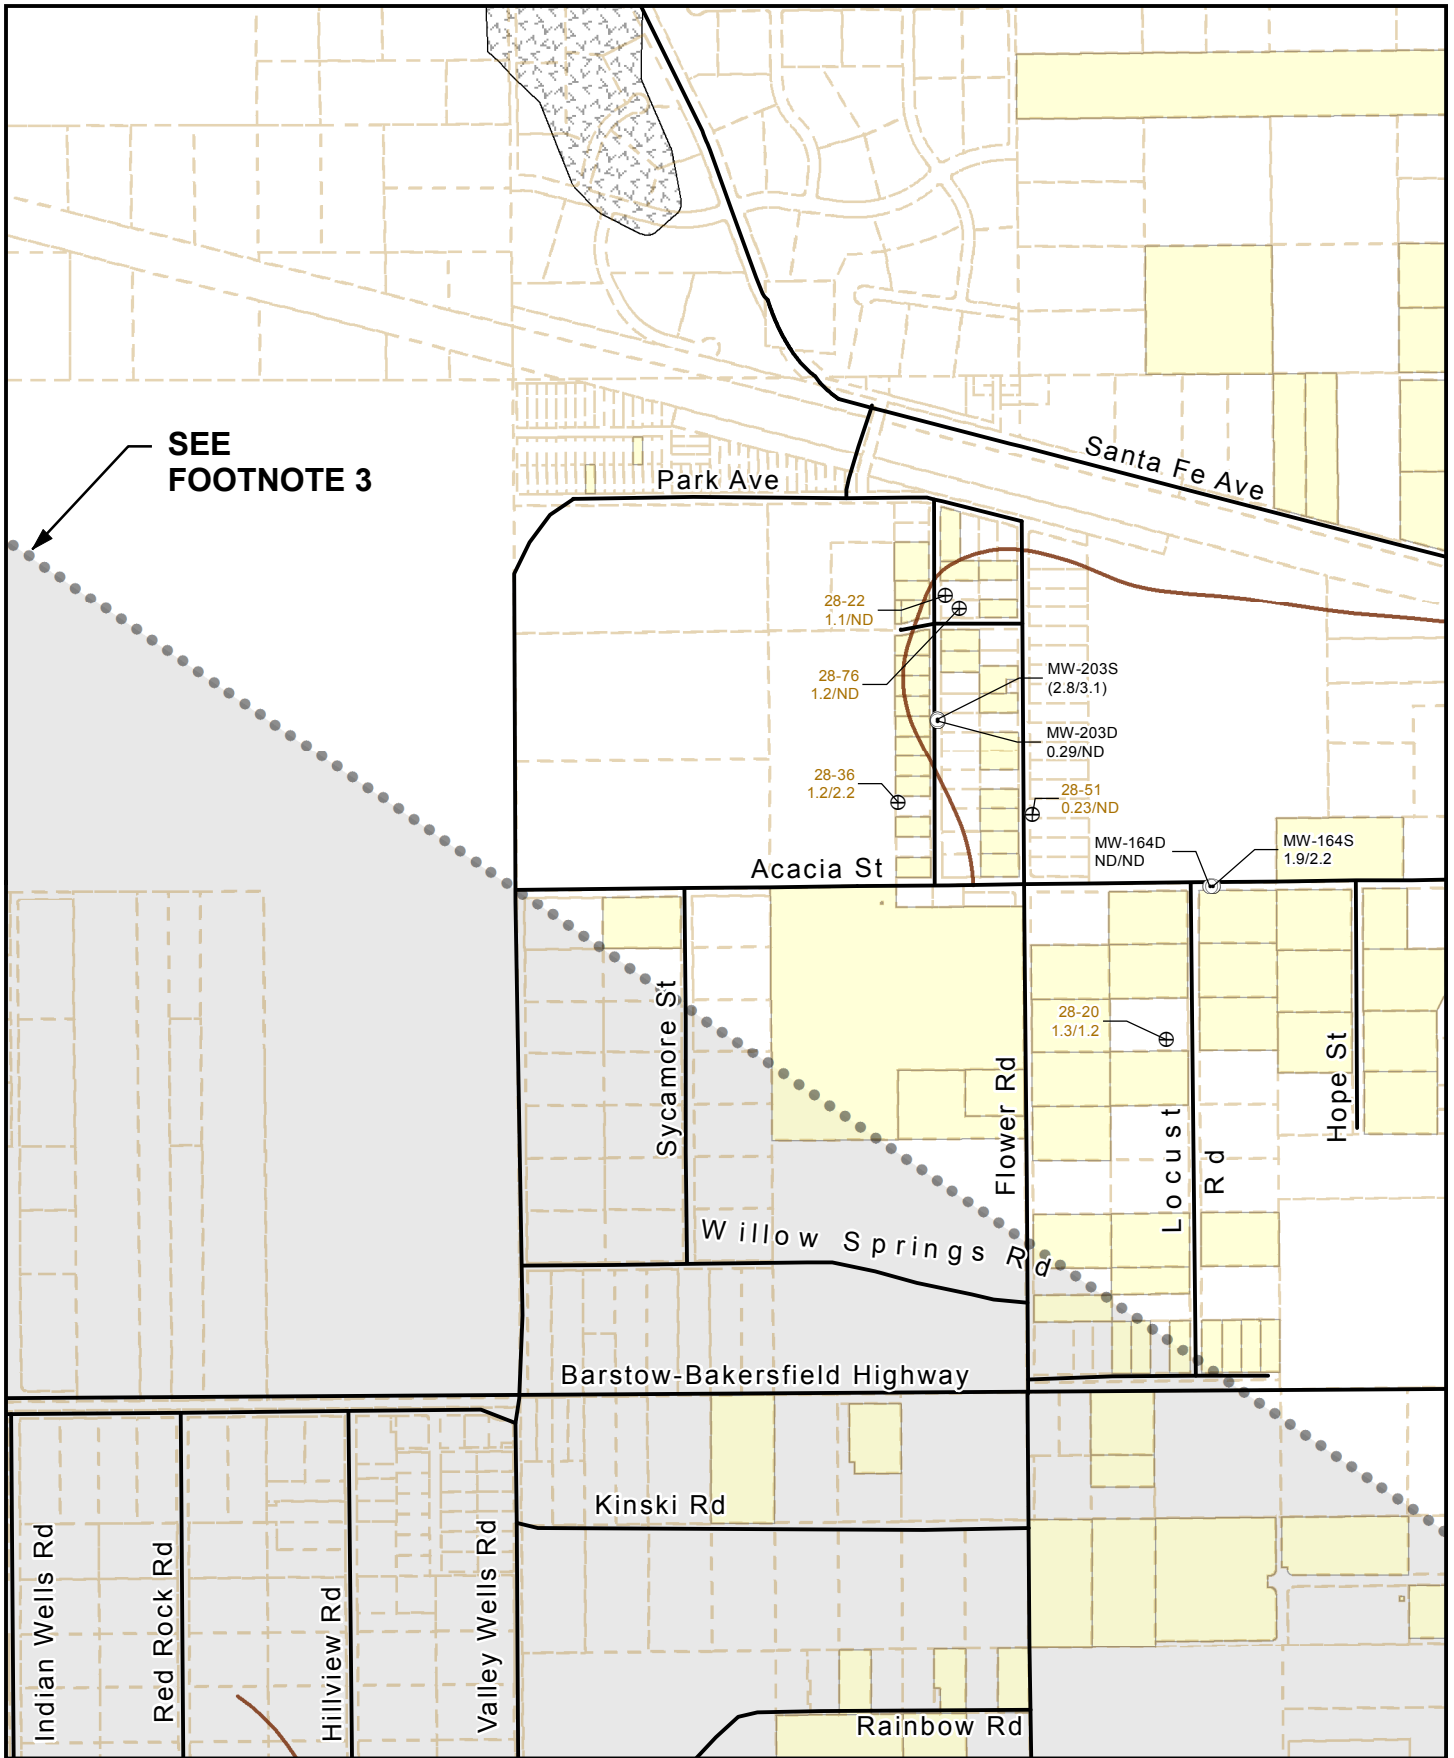


SEE FOOTNOTE 3


See Legend Figure for Feature Descriptions




MAP 09

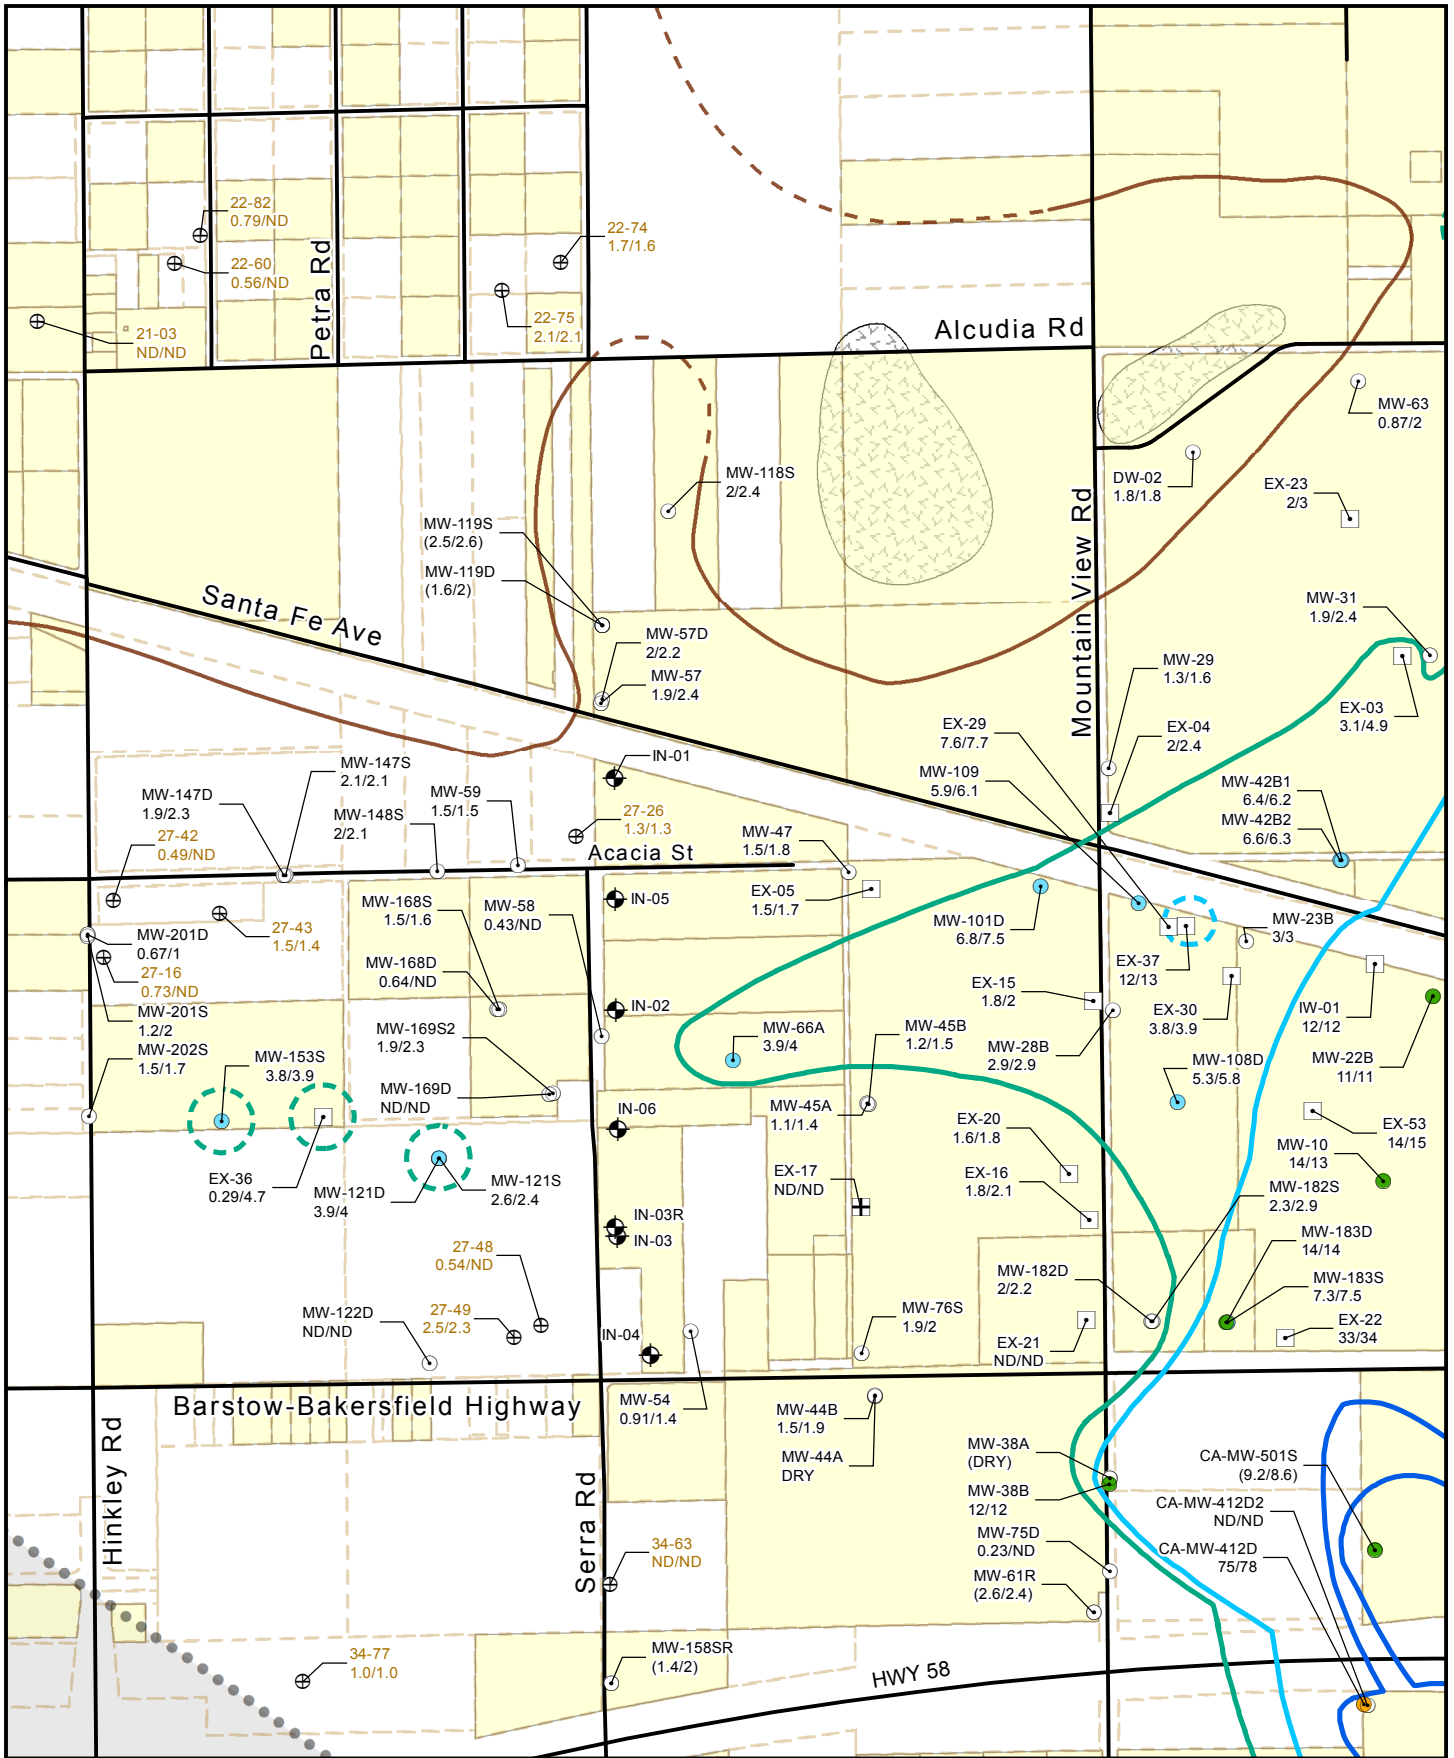


See Legend Figure for  
Feature Descriptions




MAP 10

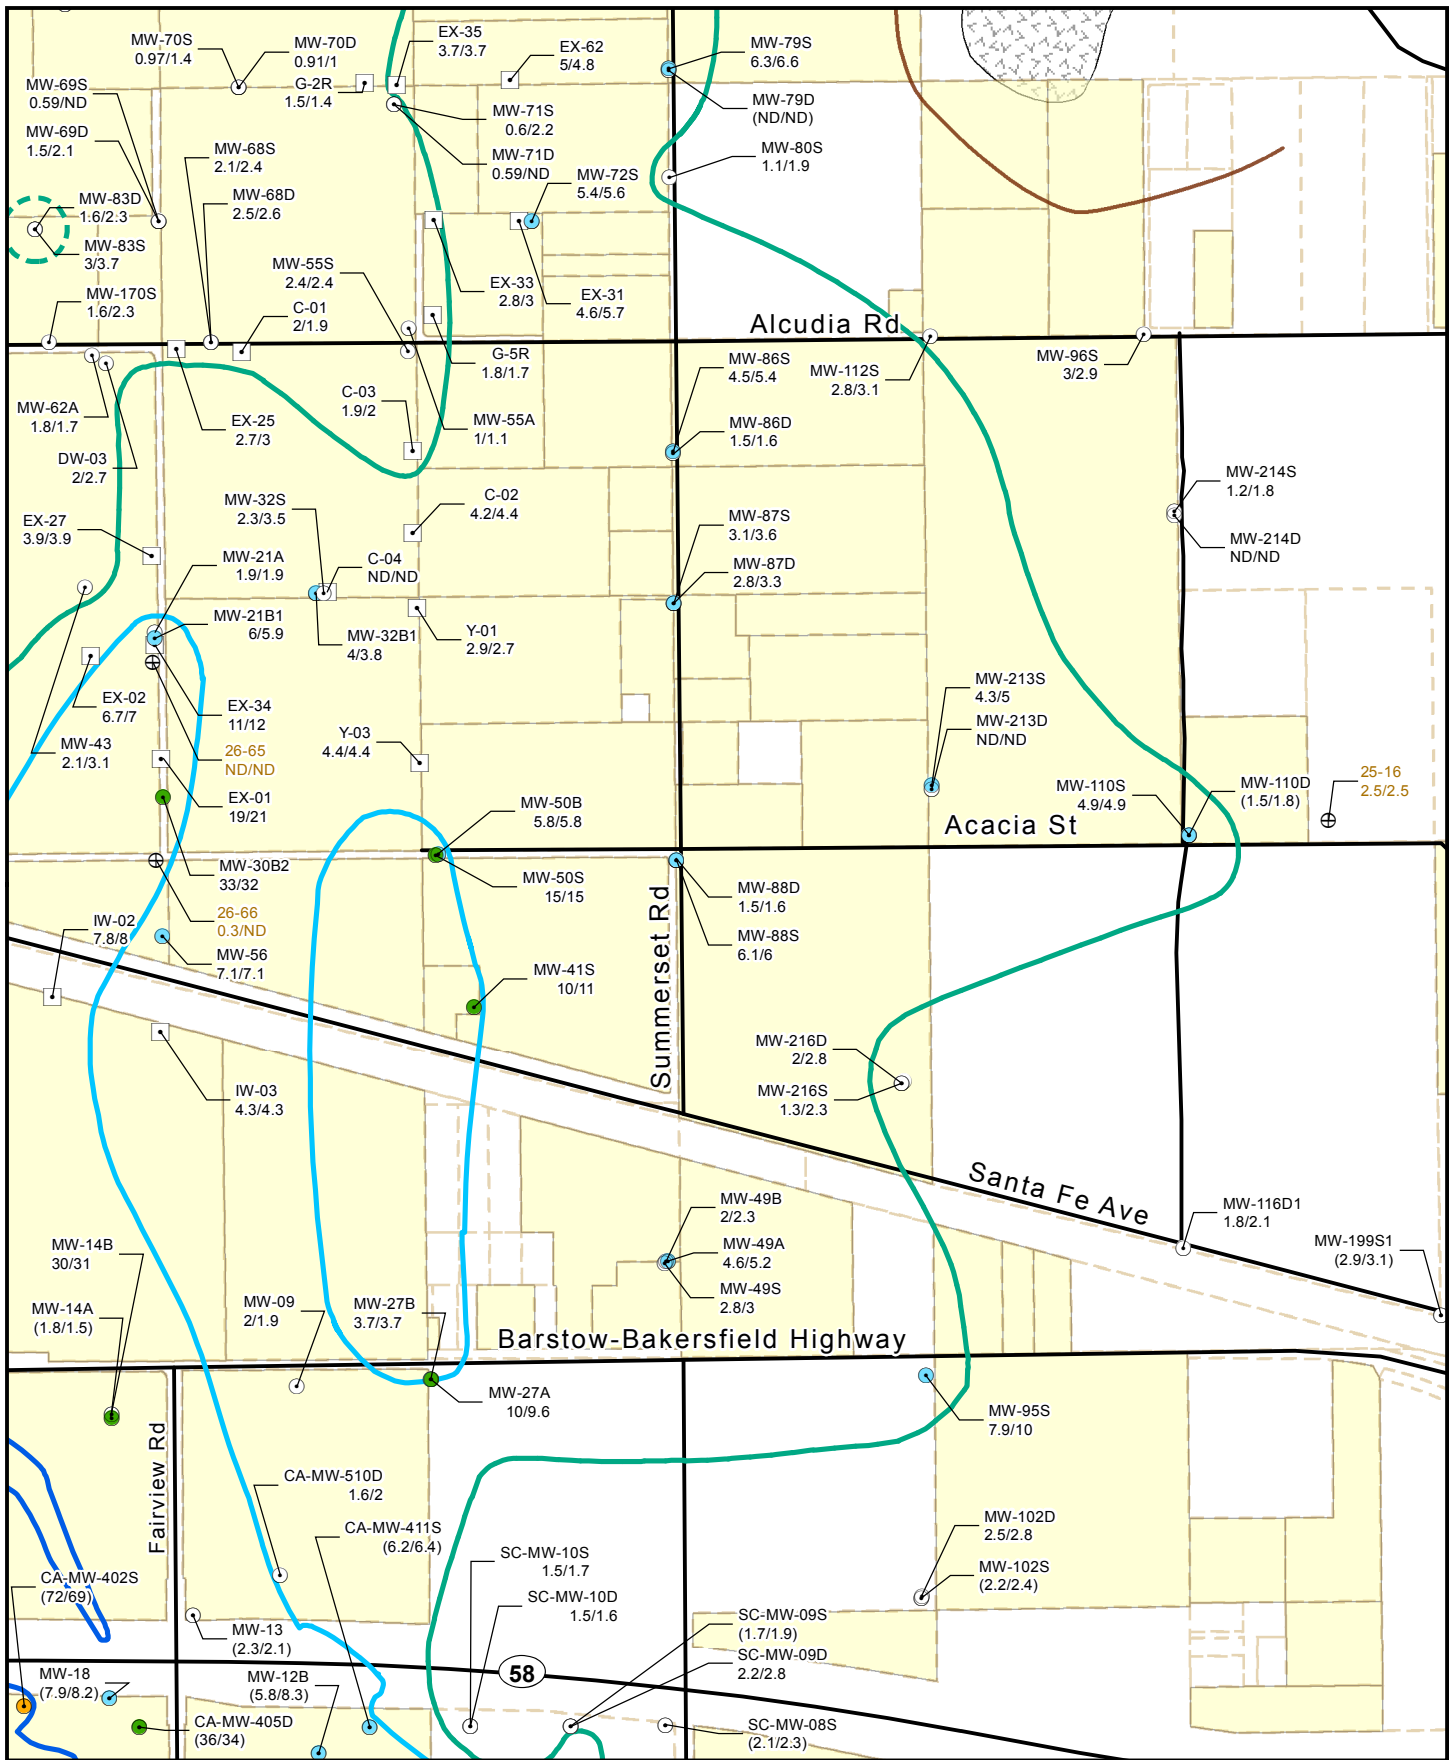


See Legend Figure for Feature Descriptions




MAP 11

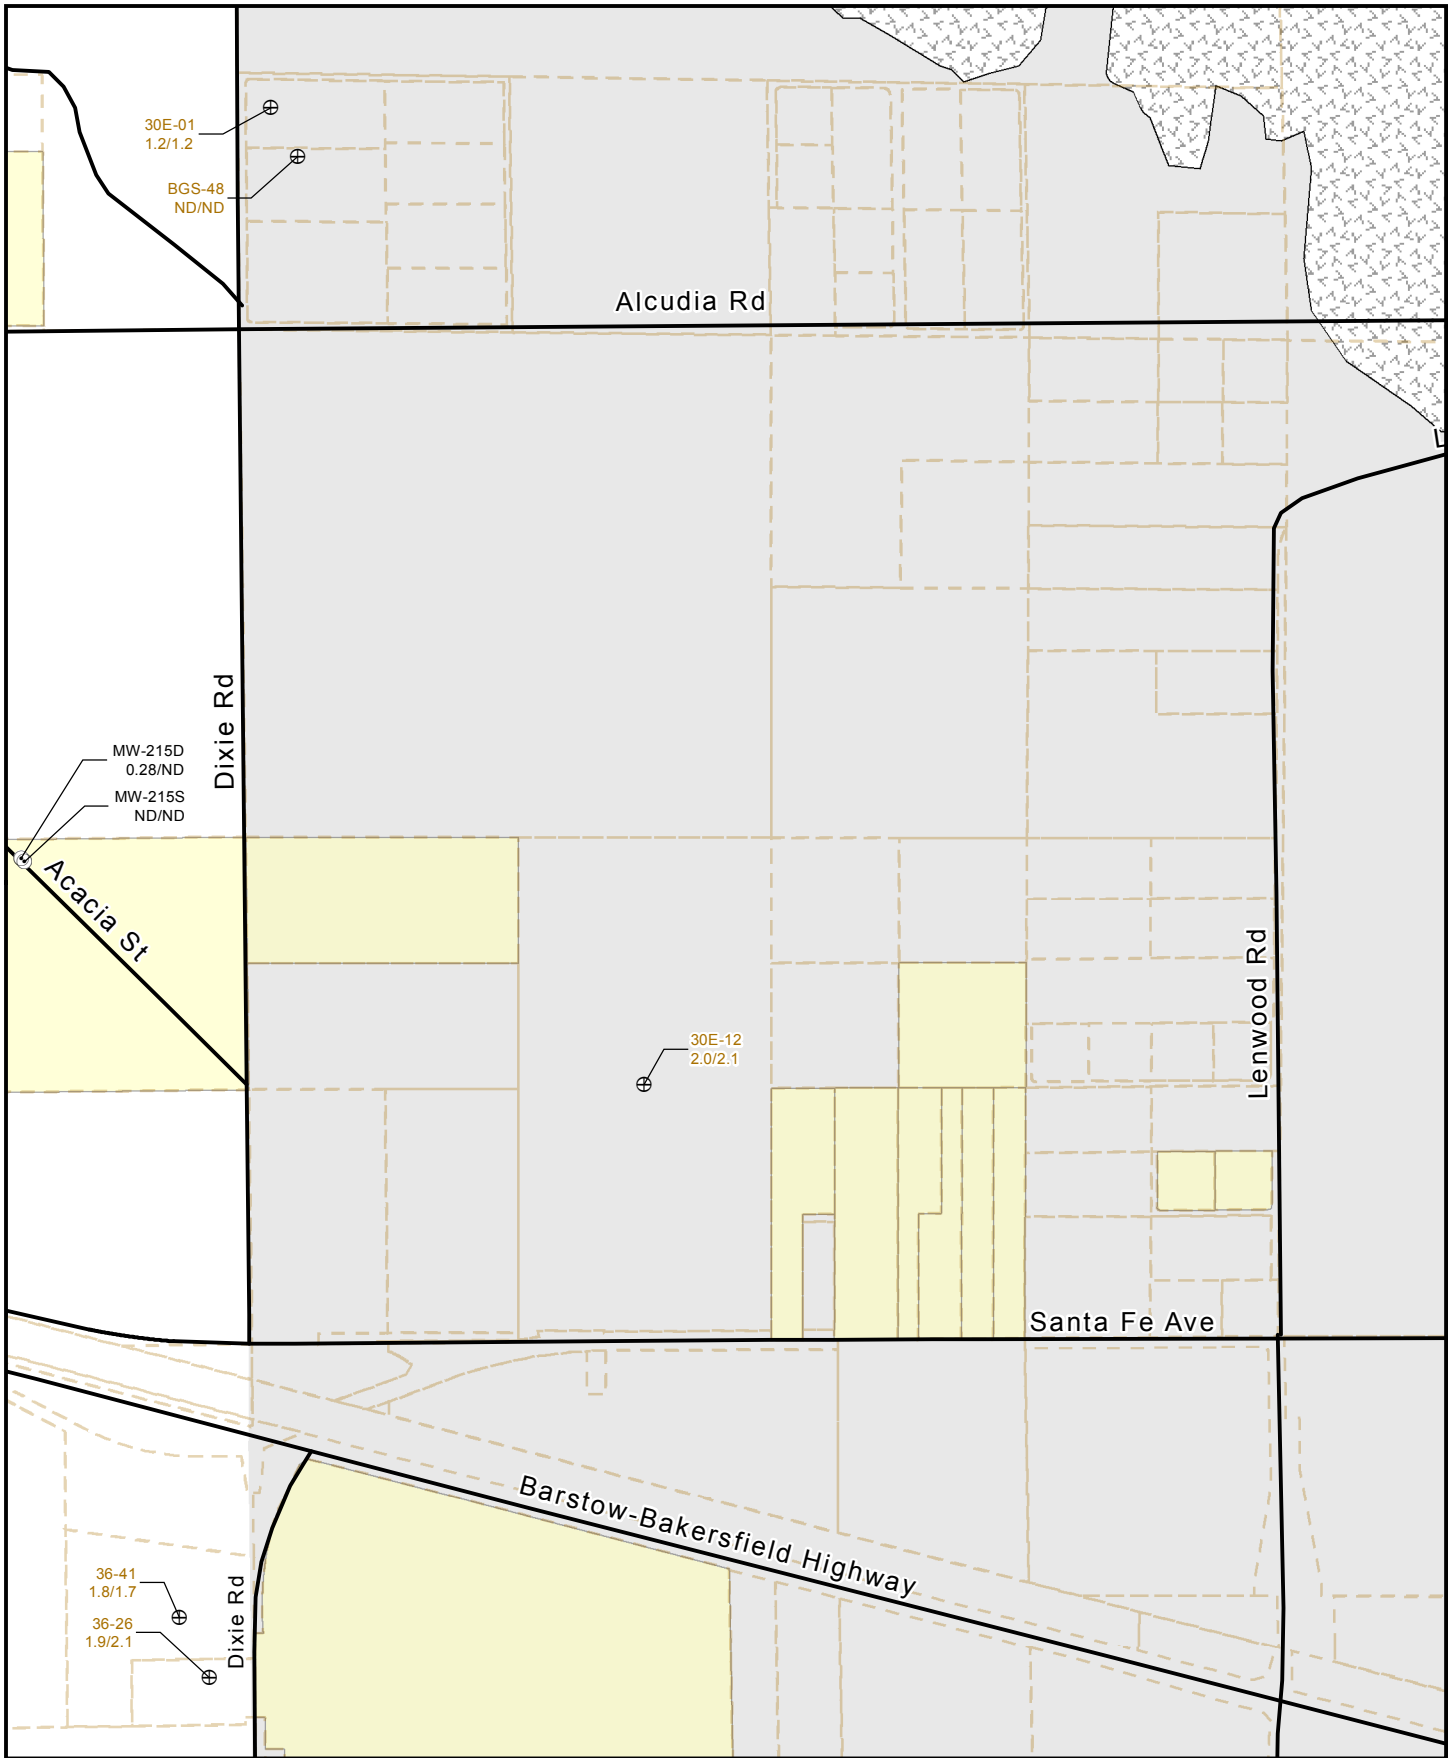

See Legend Figure for  
Feature Descriptions



MAP 12

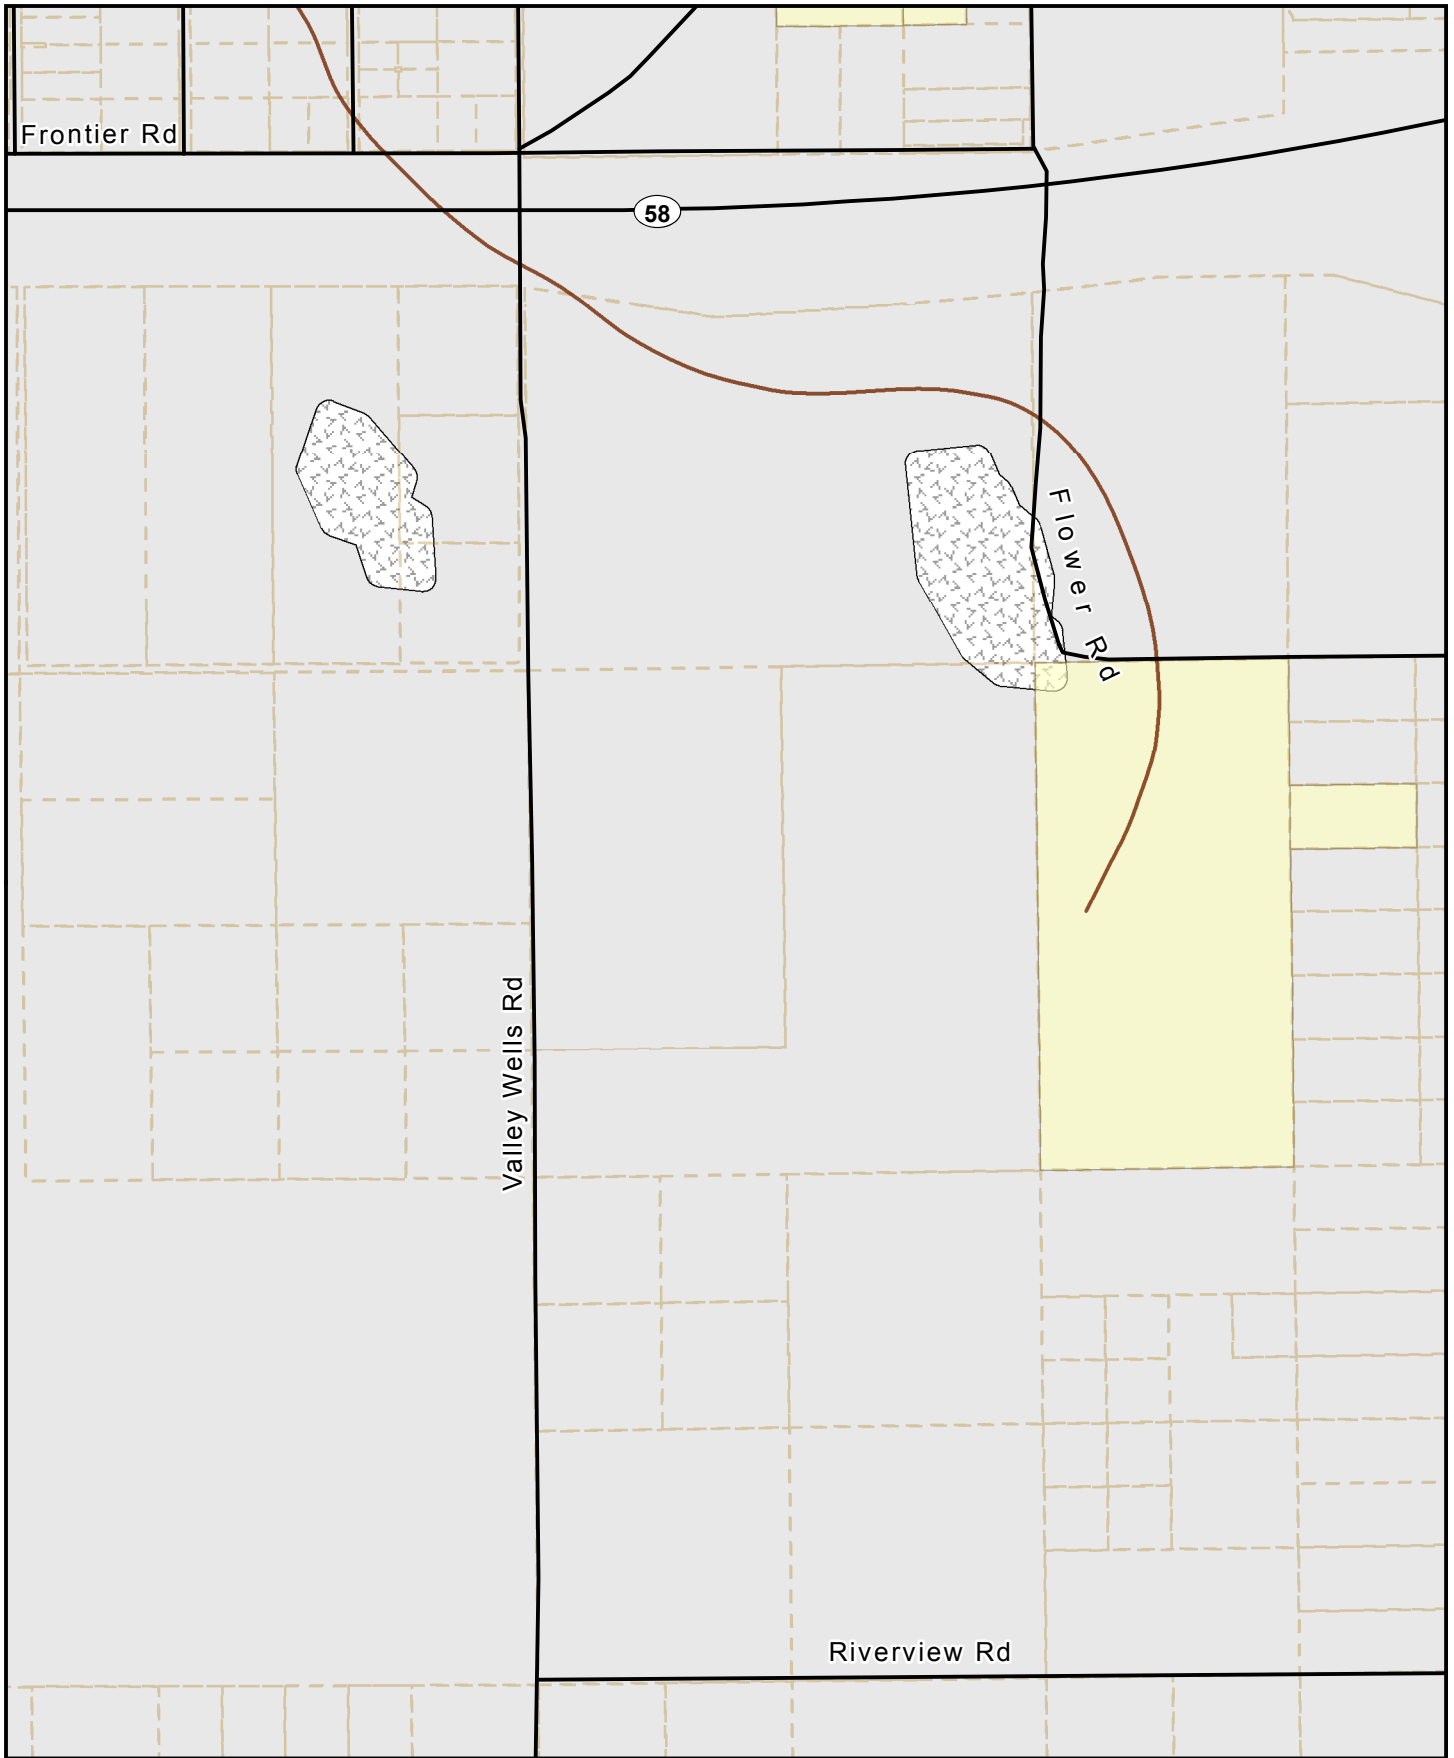

Frontier Rd


58

Flower Rd

Valley Wells Rd


Riverview Rd

**See Legend Figure for  
Feature Descriptions**




**MAP 13**




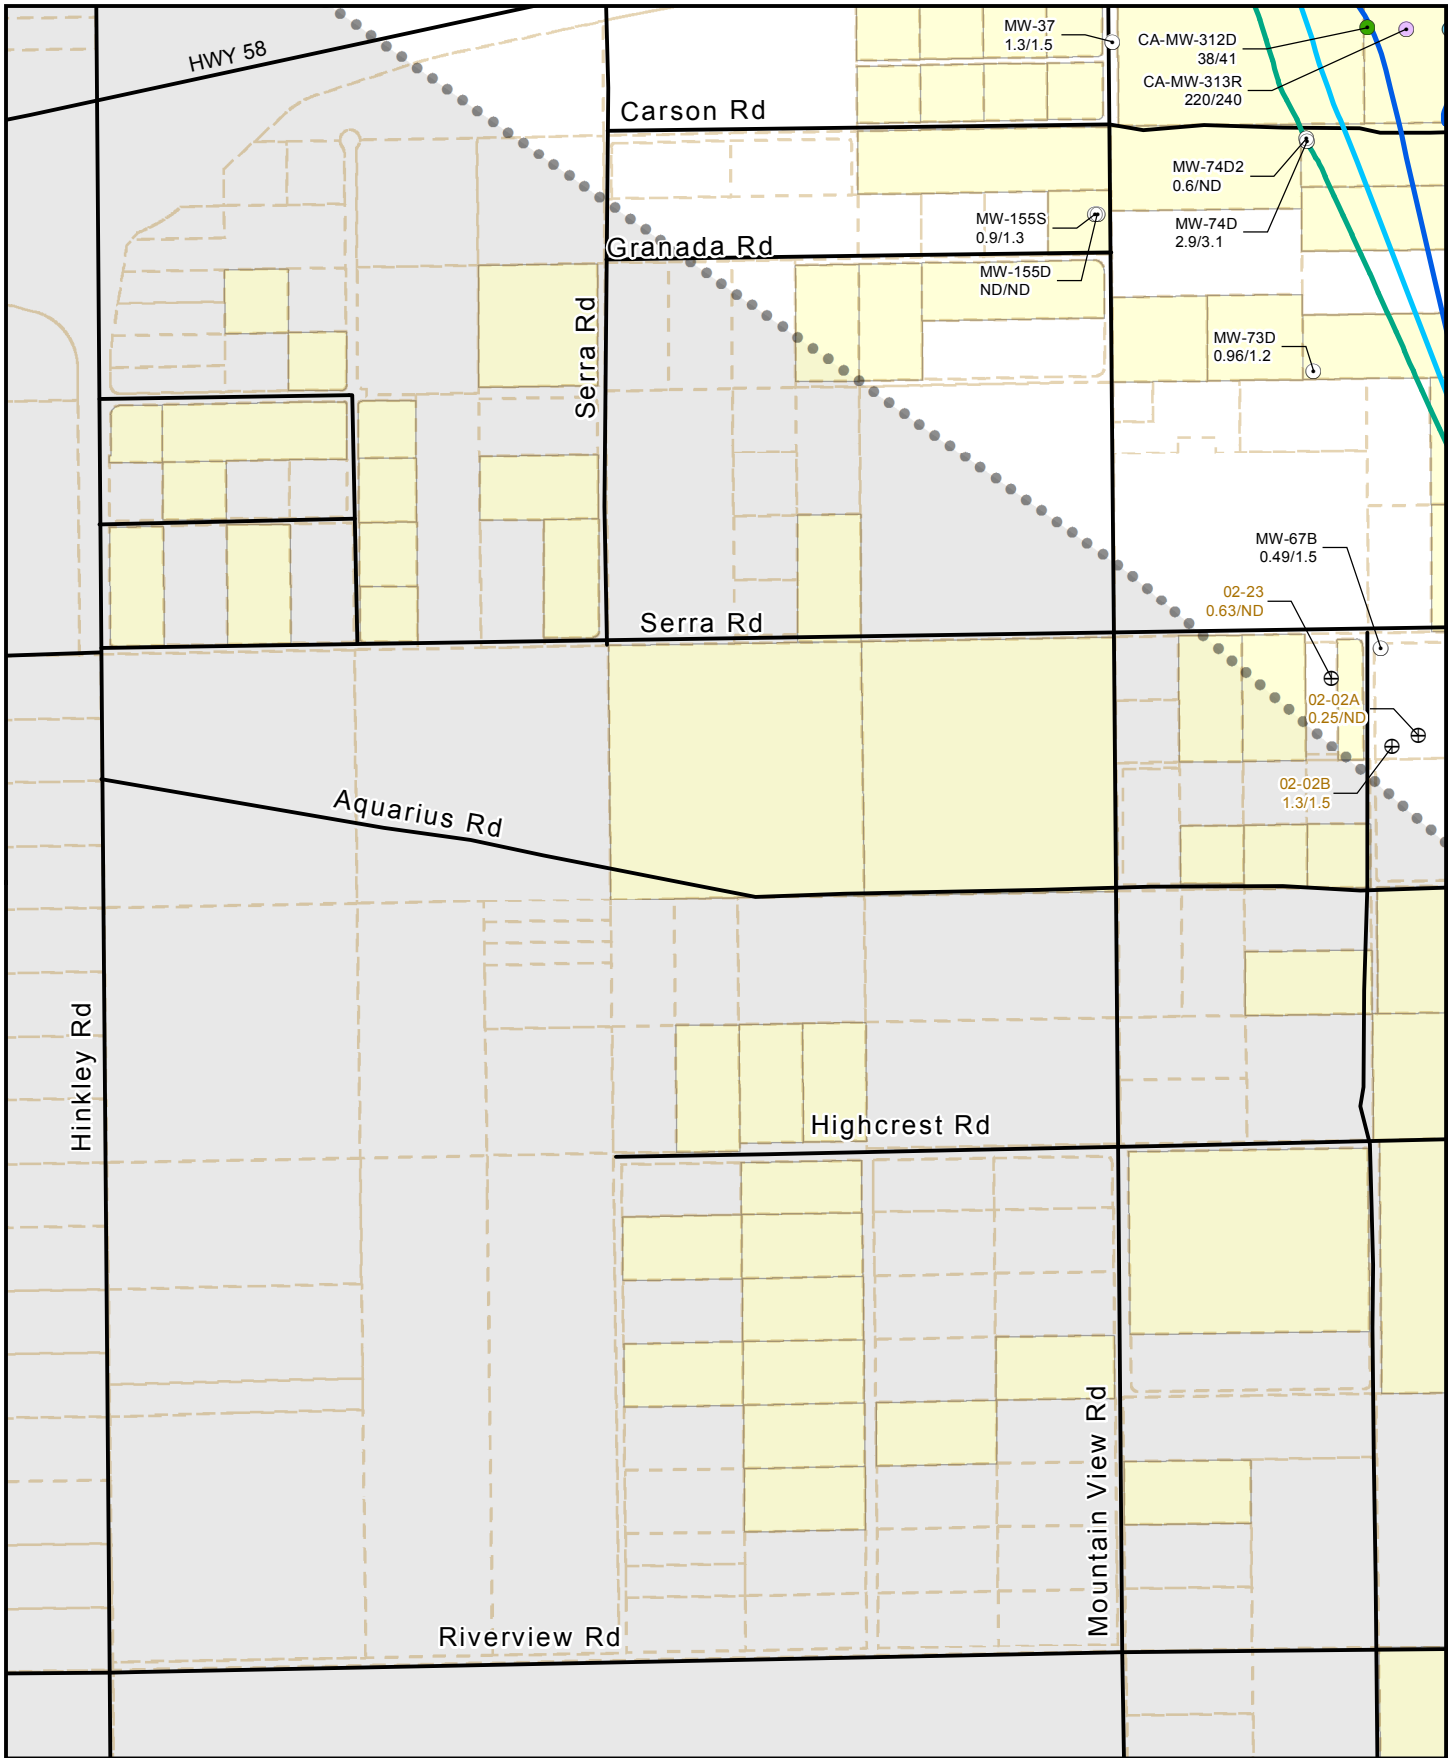


See Legend Figure for  
Feature Descriptions




**MAP 14**

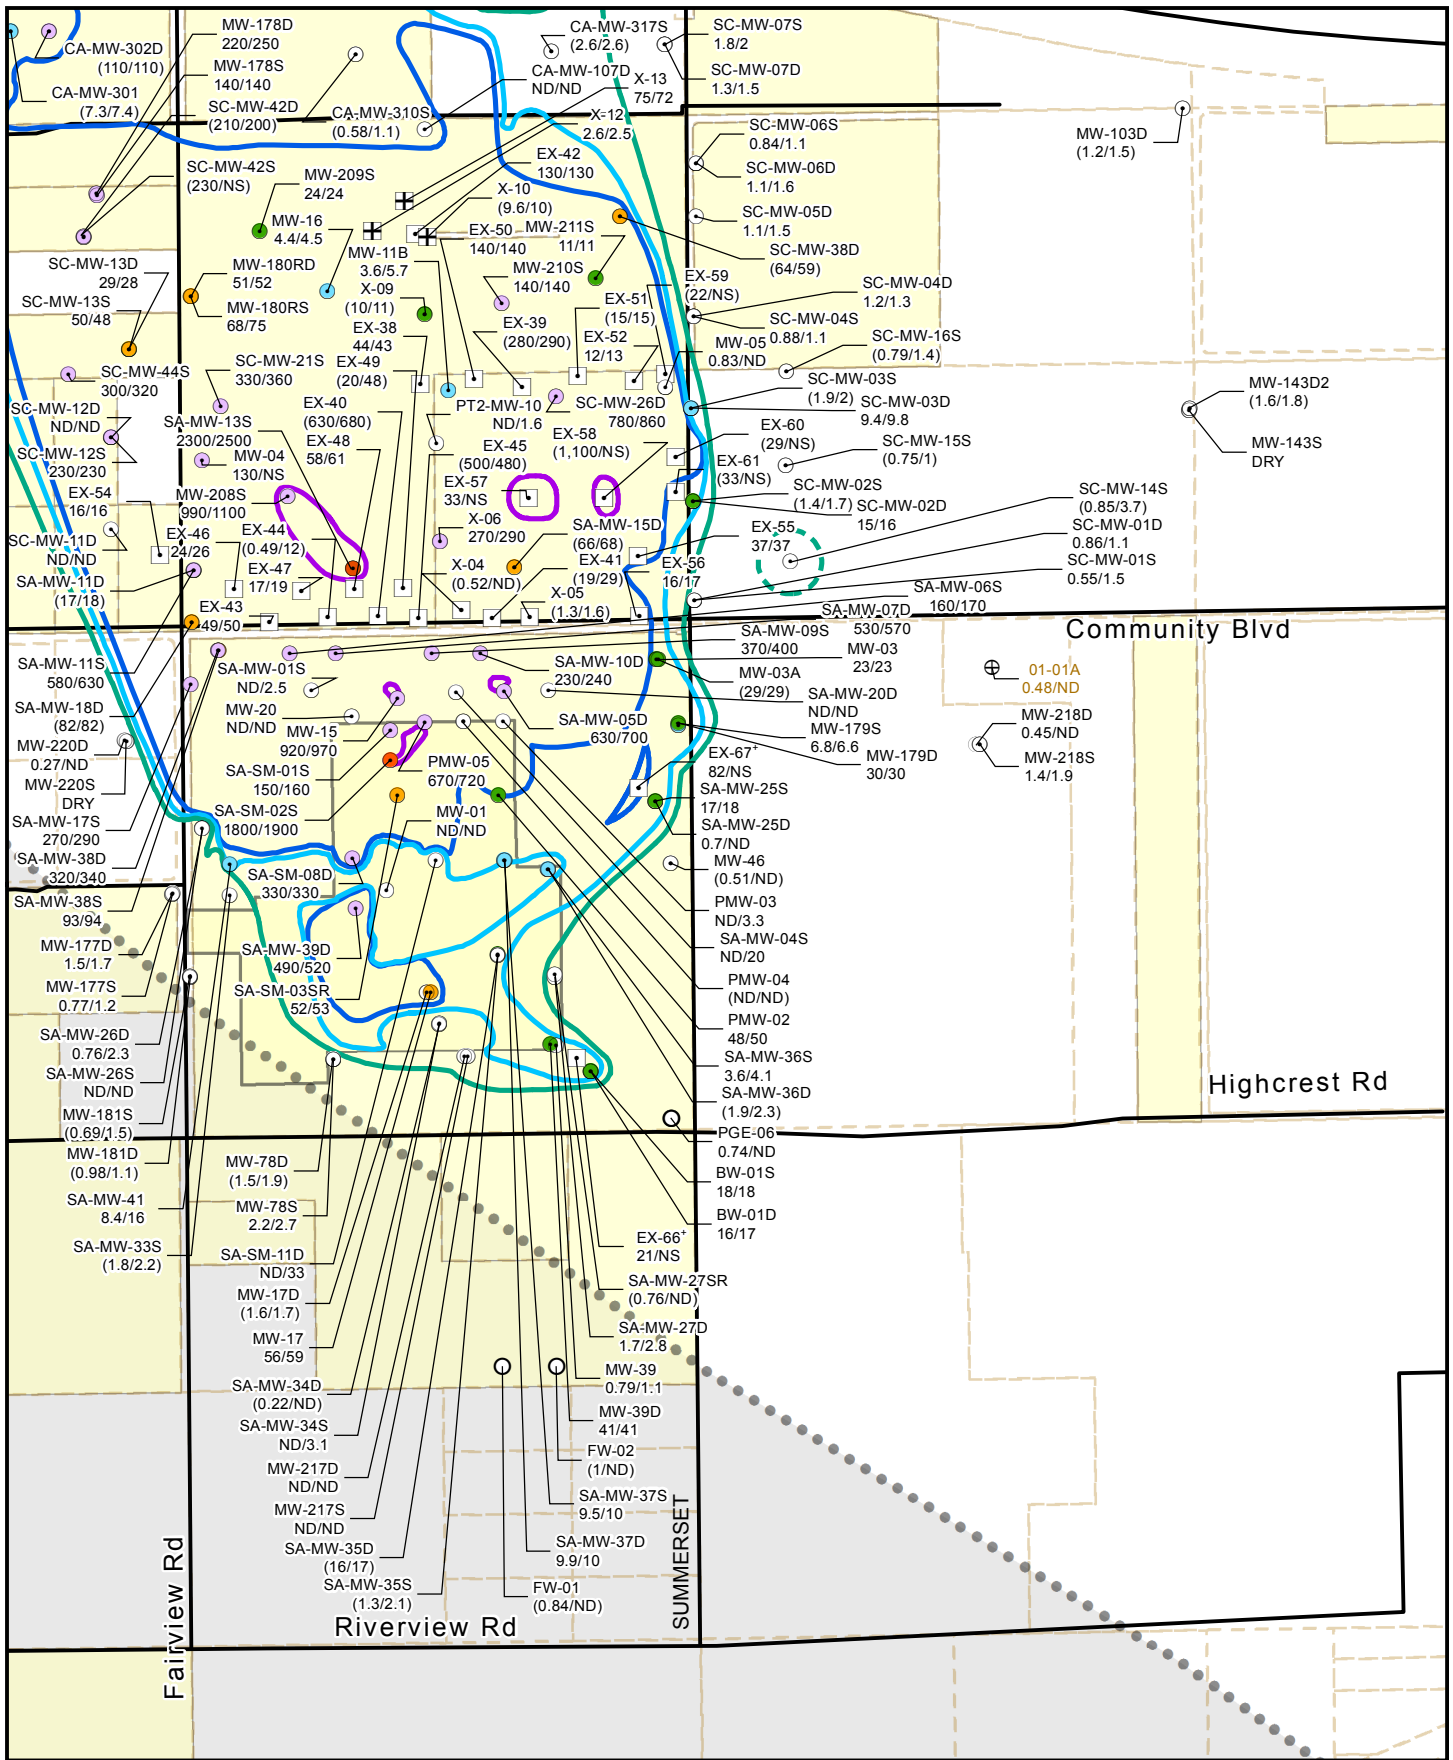


See Legend Figure for  
Feature Descriptions



MAP 15

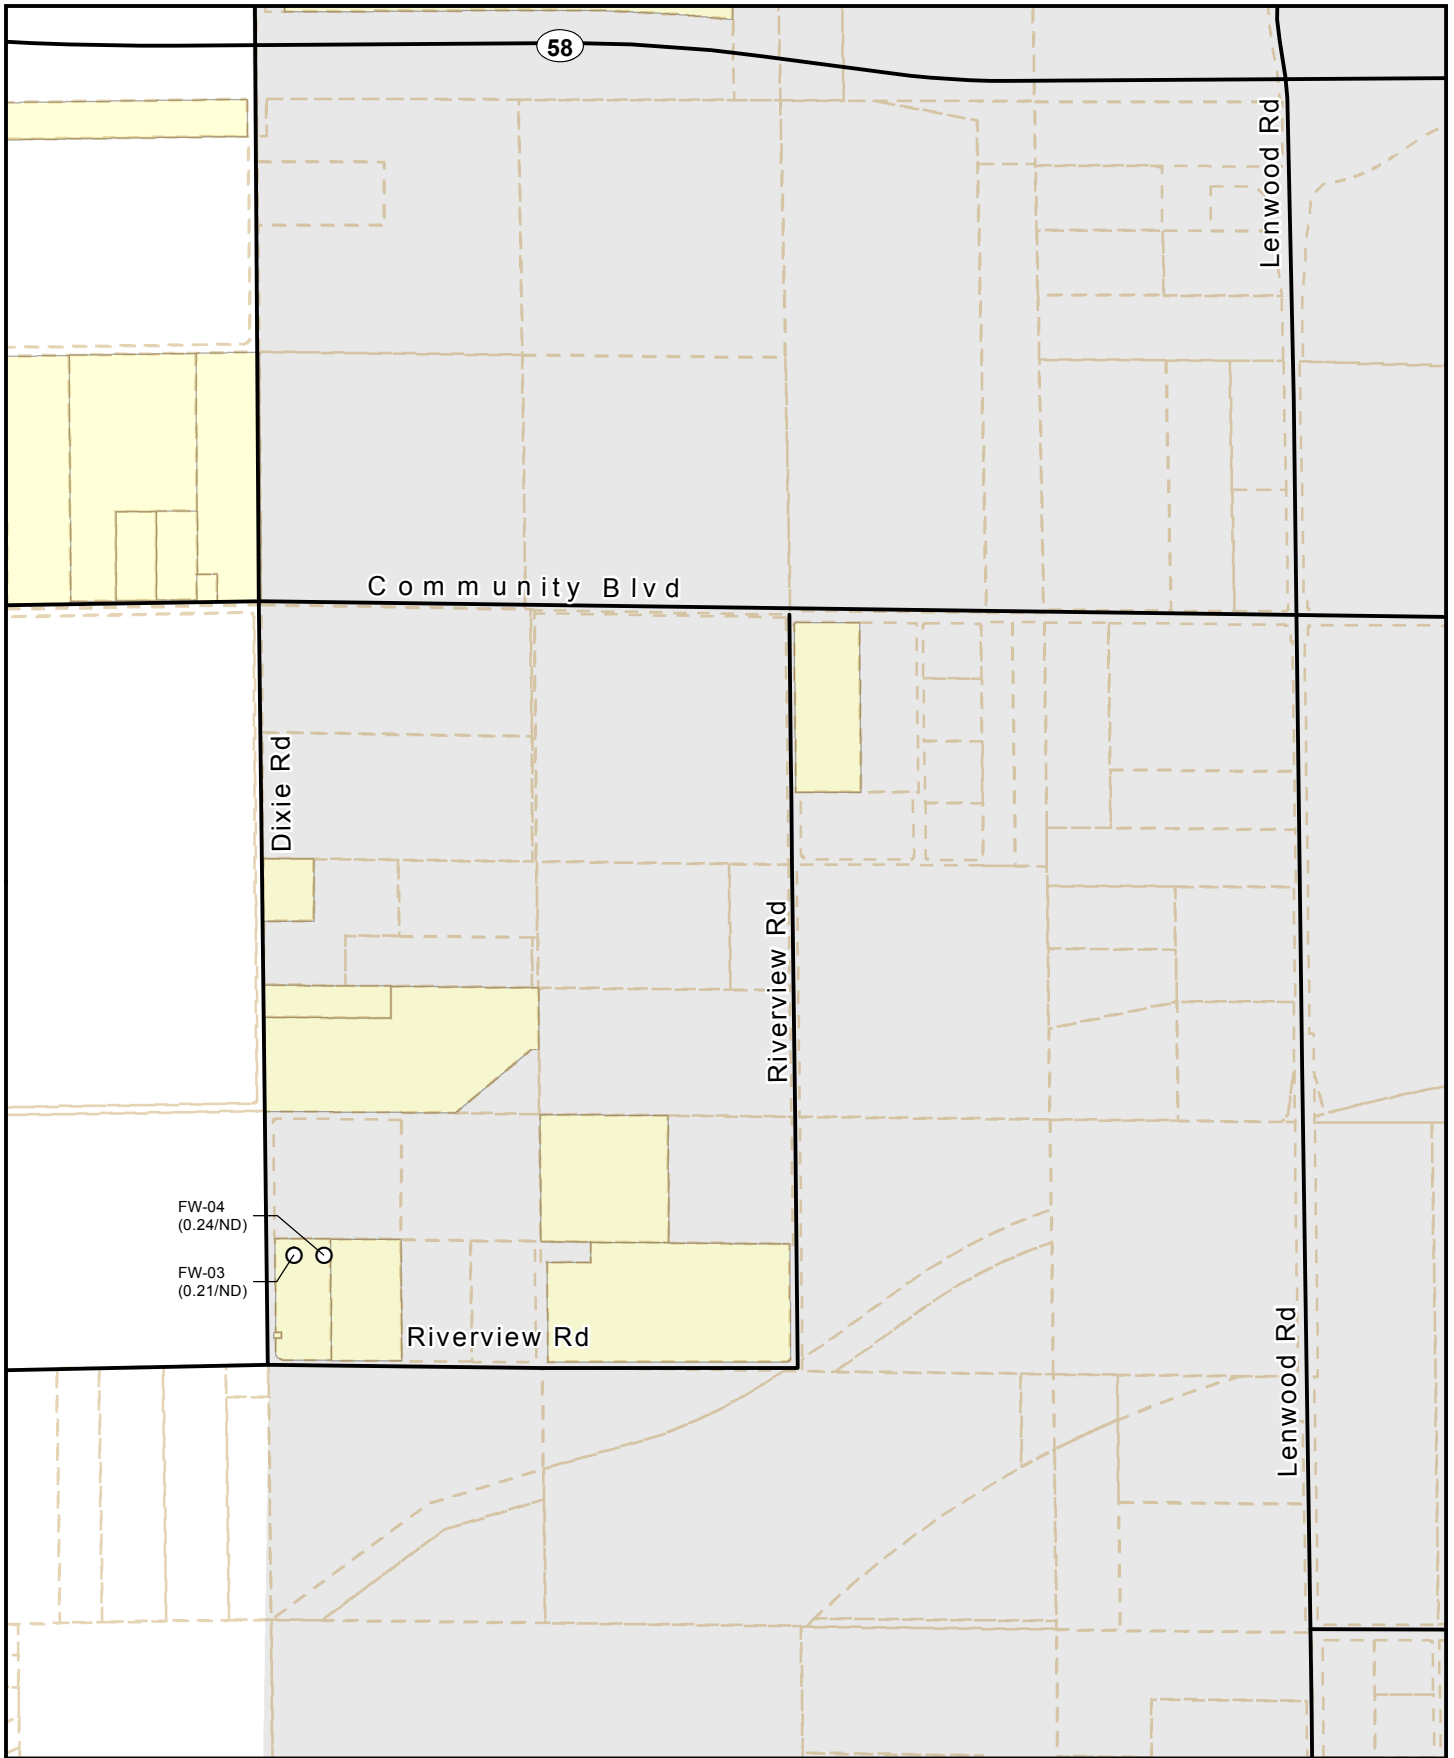

See Legend Figure for  
Feature Descriptions



**MAP 16**