## STATE OF CALIFORNIA STATE WATER RESOURCES CONTROL BOARD

#### ORDER WQ 2014-0054-UST

# In the Matter of Underground Storage Tank Case Closure Pursuant to Health and Safety Code Section 25296.10

## BY THE BOARD:

By this order, the State Water Resources Control Board (State Water Board) directs closure of the underground storage tank (UST) case at the site listed below, pursuant to section 25296.10 of the Health and Safety Code<sup>1</sup>. The name of the responsible party, the site name, the site address, the Underground Storage Tank Cleanup Fund (Fund) claim number if applicable, current and former lead agencies, and case number are as follows:

Mr. Norman Dillinger (Responsible Party)

Eagle Industries (Former)

1517 West Esther Street, Long Beach, California 90813

Los Angeles Regional Water Quality Control Board, Case No. 908130634

#### I. STATUTORY AND PROCEDURAL BACKGROUND

Upon review of a UST case, the State Water Board may close or require closure of a UST case where an unauthorized release has occurred, if the State Water Board determines that corrective action at the site is in compliance with all of the requirements of subdivisions (a) and (b) of section 25296.10. The State Water Board, or in certain cases the State Water Board Executive Director, may close a case or require the closure of a UST case. Closure of a UST case is appropriate where the corrective action ensures the protection of human health, safety, and the environment and where the corrective action is consistent with: 1) Chapter 6.7 of division 20 of the Health and Safety Code and implementing regulations; 2) Any applicable waste discharge requirements or other orders issued pursuant to division 7 of the Water Code;

<sup>&</sup>lt;sup>1</sup> Unless otherwise noted, all references are to the California Health and Safety Code.

3) All applicable state policies for water quality control; and 4) All applicable water quality control plans.

On May 1, 2012, the State Water Board adopted Resolution No. 2012-0016, the Low-Threat Underground Storage Tank Case Closure Policy (Low-Threat Closure Policy or Policy). This Policy, which is a state policy for water quality control, provides standard closure criteria for petroleum UST cases. Resolution No. 92-49 governs all investigations and cleanups under Water Code section 13304. If a petroleum UST case does not meet the closure criteria in the Low-Threat Closure Policy, regulatory agencies are required to consider case closure pursuant to Resolution No. 92-49.

State Water Board staff has completed a review of the UST case identified above, and recommends that the case be closed. The recommendation is based upon the facts and circumstances of this particular UST case. A UST Case Closure Summary has been prepared for the case identified above. The factors considered in determining compliance with the Low-Threat Closure Policy and State Water Board Resolution No. 92-49 are explained in the Case Closure Summary.

## **Low-Threat Closure Policy**

In State Water Board Resolution No. 2012-0016, the State Water Board adopted the Low-Threat Closure Policy. The Policy became effective on August 17, 2012. The Policy establishes consistent statewide case closure criteria for certain low-threat petroleum UST sites. In the absence of unique attributes or site-specific conditions that demonstrably increase the risk associated with residual petroleum constituents, cases that meet the general and media-specific criteria in the Low-Threat Closure Policy pose a low-threat to human health, safety, and the environment and are appropriate for closure under Health and Safety Code section 25296.10.

## State Water Board Resolution No. 92-49

State Water Board Resolution No. 92-49, *Policies and Procedures for Investigation and Cleanup and Abatement of Discharges Under Water Code, section 13304* is a state policy for water quality control and applies to UST cases. State Water Board Resolution No. 92-49 directs that water affected by an unauthorized release attain either background water quality or the best water quality that is reasonable if background water quality cannot be restored. (State Water Board Resolution No. 92-49, section III.G.) Any alternative level of water quality less stringent than background must be consistent with the maximum benefit to the people of the state, not unreasonably affect current and anticipated beneficial use of affected water, and not result in

water quality less than that prescribed in the water quality control plan for the basin within which the site is located. (*Ibid.*) Resolution No. 92-49 does not require, however, that the requisite level of water quality be met at the time of site closure. Resolution No. 92-49 specifies compliance with cleanup goals and objectives within a reasonable time frame (*Id.* at section III.A.). Therefore, even if the requisite level of water quality has not yet been attained, a site may be closed if the level will be attained within a reasonable period.

Health and Safety Code section 25299.57, subdivision (I)(1) provides that claims for reimbursement of corrective action costs that are received by the Fund more than 365 days after the date of a uniform closure letter or a letter of commitment, whichever occurs later, shall not be reimbursed unless specified conditions are satisfied.

## **II. FINDINGS**

Based upon the UST Case Closure Summary prepared for this case and attached hereto, the State Water Board finds that corrective action taken to address the unauthorized release at the UST release site identified as:

Mr. Norman Dillinger (Responsible Party)

Eagle Industries (Former)

1517 West Esther Street, Long Beach, California 90813

Los Angeles Regional Water Quality Control Board, Case No. 908130634

ensure protection of human health, safety, and the environment and is consistent with chapter 6.7 of division 20 of the Health and Safety Code, and implementing regulations, and other water quality control policies and applicable water quality control plans.

Notification has been provided to all entities that are required to receive notice of the proposed case closure, a 60 day comment period has been provided to notified parties, and any comments received have been considered by the State Water Board in determining that the case should be closed.

The UST case identified above may be the subject of orders issued by the Regional Water Quality Control Board (Regional Water Board) pursuant to division 7 of the Water Code. Any orders that have been issued by the Regional Water Board pursuant to division 7 of the Water Code, or directives issued by a Local Oversight Program (LOP) agency for the case should be rescinded to the extent they are inconsistent with this Order.

#### III. ORDER

## **IT IS THEREFORE ORDERED** that:

- A. The UST case identified in Section II of this Order be closed in accordance with the following conditions and after the following actions are complete. Prior to the issuance of a uniform closure letter, the responsible party is ordered to:
  - 1. Properly destroy monitoring wells and borings unless the owner of real property on which the well or boring is located certifies that the wells or borings will be maintained in accordance with local or state requirements;
  - 2. Properly remove from the site and manage all waste piles, drums, debris, and other investigation and remediation derived materials in accordance with local or state requirements; and
  - 3. Within six months of the date of this Order, submit documentation to the regulatory agency overseeing the UST case identified in Section II of this Order that the tasks in subparagraphs (1) and (2) have been completed.
- B. The tasks in subparagraphs (1) and (2) of Paragraph (A) are ordered pursuant to Health and Safety Code section 25296.10 and failure to comply with these requirements may result in the imposition of civil penalties pursuant to Health and Safety Code section 25299, subdivision (d)(1). Penalties may be imposed administratively by the State Water Board or Regional Water Board.
- C. Within 30 days of receipt of proper documentation from the responsible party that requirements in subparagraphs (1) and (2) of Paragraph (A) are complete, the regulatory agency that is responsible for oversight of the UST case identified in Section II of this Order shall notify the State Water Board that the tasks have been satisfactorily completed.
- D. Within 30 days of notification from the regulatory agency that the tasks are complete pursuant to Paragraph (C), the Deputy Director of the Division of Water Quality shall issue a uniform closure letter consistent with Health and Safety Code section 25296.10,

subdivision (g) and upload the uniform closure letter and UST Case Closure Summary to GeoTracker.

- E. Pursuant to section 25299.57, subdivision (I) (1), and except in specified circumstances, all claims for reimbursement of corrective action costs must be received by the Fund within 365 days of issuance of the uniform closure letter in order for the costs to be considered.
- F. Any Regional Water Board or LOP agency directive or order that directs corrective action or other action inconsistent with case closure for the UST case identified in Section II is rescinded, but only to the extent the Regional Water Board order or LOP agency directive is inconsistent with this Order.

## **CERTIFICATION**

The undersigned, Clerk to the Board, does hereby certify that the foregoing is a full, true, and correct copy of an order duly and regularly adopted at a meeting of the State Water Resources Control Board held on April 1, 2014.

AYE: Chair Felicia Marcus

Vice Chair Frances Spivy-Weber Board Member Tam M. Doduc Board Member Steven Moore Board Member Dorene D'Adamo

NAY: None ABSENT: None ABSTAIN: None

Jeanine Townsend
Clerk to the Board







#### **State Water Resources Control Board**

## **UST CASE CLOSURE SUMMARY (REVISED 1/23/14)**

**Agency Information** 

Agency Name: Los Angeles Regional Water	Address: 320 West 4 <sup>th</sup> Street, Suite 200
Quality Control Board (Regional Board)	Los Angeles, CA 90013
Agency Caseworker: David Bjostad	Case No.: 908130634

#### **Case Information**

USTCF Claim No.: not applicable	Global ID: T0603792998
Site Name: Eagle Industries (Former)	Site Address: 1517 West Esther Street
	Long Beach, CA 90813 (Site)
Responsible Party: Mr. Norman Dillinger	Address: Private Residence
USTCF Expenditures to Date: not applicable	Number of Years Case Open: 13

**URL:** http://geotracker.waterboards.ca.gov/profile report.asp?global id=T0603792998

## Summary

The Low-Threat Underground Storage Tank Case Closure Policy (Policy) contains general and media-specific criteria, and cases that meet those criteria are appropriate for closure pursuant to the Low-Threat Policy. This Case does **NOT** satisfy **GENERAL CRITERIA b** of the Policy, which requires the unauthorized release to consist only of petroleum. This Site meets all of the required criteria of the State Water Resources Control Board Resolution 92-49. A summary evaluation of compliance with the Resolution 92-49 is shown in **Attachment 1: Compliance with State Water Board Policies and State Law.** The Conceptual Site Model (CSM) upon which the evaluation of the case has been made is described in **Attachment 2: Summary of Basic Site Information.** Highlights of the CSM upon which the evaluation of the Case has been made are as follows:

The release at this Site was discovered in 2000 after a site investigation was conducted. Three underground storage tanks (USTs) existed on-Site and stored gasoline and dry-cleaning solvents. A Phase I Environmental Site Assessment, completed in 2011, indicates that an additional UST or an above ground storage tank may have also existed on the Site. One 280 gallon UST was removed from the Site in March 1973. The remaining USTs were removed from the Site between 1973 and 1998. The tank pits are reported to be filled with concrete. The Site record contains limited groundwater data, however the Site is upgradient and adjacent to a former UST site (Los Angeles Regional Water Quality Control Board [Regional Water Board] Case No. 908100143, aka Castle Car Wash) that was closed in 1998. Prior to case closure, groundwater monitoring wells installed at the Castle Car Wash provided delineation of the Site plume. The Castle Car Wash groundwater monitoring wells were located directly downgradient of the Site and exhibited decreasing trends from 1993 to case closure in 1998.



Eagle Industries (Former) 1517 West Esther Street, Long Beach

One of the grab groundwater samples collected at the Site in April 2000 contained a low concentration of cis-1,2-Dichloroethene (cis-1,2-DCE). However, this volatile organic compound (VOC) is not a risk driver at the Site for the following reasons:

- The concentration is only slightly above Water Quality Objectives (WQOs). Due to the age of the sample, it is likely that the concentration has reduced to below WQOs;
- The concentration is significantly lower than San Francisco Bay Regional Water Board Environmental Screening Levels (ESL) for Vapor Intrusion to Indoor Air from groundwater;
- This constituent is not present in in the grab groundwater samples collected in 2012 south of the facility; and
- All soil data analyzed for VOCs were non-detect for cis-1,2-DCE.

VOC 1,2-dichloroethane (1,2-DCA) was also detected at low concentrations in groundwater in 2000. 1,2-DCA was used as a lead scavenger and is usually associated with petroleum releases. As such, the State Water Board staff considers the primary release at the Site to be petroleum hydrocarbons from the USTs.

The petroleum release is limited to the shallow soil and shallow groundwater. The affected groundwater is not currently being used as a source of drinking water or for any other designated beneficial use, and it is highly unlikely that the affected groundwater will be used as a source of drinking water or for any other beneficial use in the foreseeable future. Public supply wells are usually constructed with competent sanitary seals and intake screens that are in deeper more protected aquifers. Remaining petroleum constituents are limited, stable, and declining. Remedial actions have been implemented and further remediation would be ineffective and expensive. Additional assessment/monitoring will not likely change the CSM. Any remaining petroleum constituents do not pose significant risk to human health, safety or the environment under current conditions.

## **Objections to Closure**

The Regional Water Board does not object to closure of the Site for the petroleum hydrocarbons or the residual VOCs.

#### **Recommendation for Closure**

The corrective action performed at this Site ensures the protection of human health, safety, the environment and is consistent with chapter 6.7 of the Health and Safety Code and implementing regulations, applicable state policies for water quality control and the applicable water quality control plan, and case closure is recommended.

Prepared By: Stul Mallate	1/23/14
Steve McMasters, P.G. No. 8054	Date
Engineering Geologist	
0 0 1/	1/23/14
Reviewed By: Amylong	
Benjamin Heningburg, P.G. No. 8130	Date
Senior Engineering Geologist	

## ATTACHMENT 1: COMPLIANCE WITH STATE WATER BOARD POLICIES AND STATE LAW

The Site complies with State Water Board policies and state law. Section 25296.10 of the Health and Safety Code requires that sites be cleaned up to protect human health, safety, and the environment. Based on available information, any residual petroleum constituents at the Site do not pose significant risk to human health, safety, or the environment.

The Site complies with the requirements of Resolution 92-49 as described below.

Will corrective action performed ensure the protection of human health, safety, and the environment?  The information included in this UST Case Closure Summary supports a determination that corrective action performed at this Site will ensure the protection of human health, safety, and the environment.	⊠ Yes □	l <b>No</b>
Is corrective action consistent with Chapter 6.7 of the Health and Safety Code and implementing regulations?  The corrective action provisions contained in Chapter 6.7 of the Health and Safety Code and the implementing regulations govern the entire corrective action process at leaking UST sites. If it is determined, at any stage in the corrective action process, that UST case closure is appropriate, further compliance with corrective action requirements is not necessary. Corrective action at this Site has been consistent with Chapter 6.7 of the Health and Safety Code and implementing regulations and, since this Site meets applicable case-closure requirements, further corrective action is not necessary, unless the activity is necessary for case closure.	⊠ Yes □	l No
Have waste discharge requirements or any other orders issued pursuant to Division 7 of the Water Code been issued at this Site?	□ Yes ⊠	No
Are corrective action and UST case closure consistent with State Water Board Resolution 92-49?	⊠ Yes □	l No
Is achieving background water quality feasible?  To remove all traces of residual petroleum constituents at the Site would require significant effort and cost. Removal of all traces of residual petroleum hydrocarbon constituents (if present) that contribute to detectable concentrations in shallow groundwater can be accomplished, but would require excavation of additional soil as well as additional remediation of shallow groundwater. If complete removal of all detectable traces of petroleum constituents becomes the standard for UST corrective actions, the statewide technical and economic implications will be enormous. Because of the high costs involved and minimal benefit of attaining further reductions in concentrations of petroleum constituents at this Site, and the fact that beneficial uses are not threatened, attaining background water quality at this Site is not feasible.	□ Yes ⊠	l No

If achieving background water quality is not feasible: Is the alternative cleanup level consistent with the maximum benefit to the people of the State? It is impossible to determine the precise level of water quality that will be attained given the uncertainties about the rates of dissolution and degradation. In light of all the factors discussed above and the fact that the residual petroleum constituents will not unreasonably affect present and anticipated beneficial uses of groundwater, an acceptable level of water quality will be attained that is consistent with the maximum benefit to the people of the state.	⊠ Yes □ No
Will the alternative cleanup level unreasonably affect present and anticipated beneficial uses of water?  The aquifer beneath the Site will reach WQOs within a reasonable period of time and the surrounding aquifer is below WQOs. Groundwater concentrations will continue to reduce through natural attenuation.	□ Yes ⊠ No
Will the alternative level of water quality result in water quality less than that prescribed in applicable Basin Plan?  The final step in determining whether cleanup to a level of water quality less stringent than background is appropriate for this Site requires a determination that the alternative level of water quality will not result in water quality less than that prescribed in the relevant basin plan. Pursuant to State Water Board Resolution 92-49, a site may be closed if the basin plan requirements will be met within a reasonable time frame. Natural attenuation will continue to reduce groundwater concentrations.	□ Yes ⊠ No
Have factors contained in title 23 of the California Code of Regulations, section 2550.4 been considered?  In approving an alternative level of water quality less stringent than background, the State Water Board considers the factors contained in California Code of Regulations, title 23, section 2550.4, subdivision (d).  The adverse effect on shallow groundwater will be minimal and localized, and there will be little adverse effect on the groundwater contained in deeper aquifers, given the physical and chemical characteristics of petroleum constituents, the hydrogeological characteristics of the Site and surrounding land. In addition, the potential for adverse effects on beneficial uses of groundwater is low, in light of the proximity of the groundwater supply wells, the current and potential future uses of groundwater in the area, the existing quality of groundwater, the potential for health risks caused by human exposure, the potential damage to wildlife, crops, vegetation, and physical structures, and the persistence and permanence of potential effects.  Finally, a level of water quality less stringent than background is unlikely to have any impact on surface water quality, in light of the volume and physical and chemical characteristics of petroleum constituents; the hydrogeological characteristics of the Site and surrounding land; the quantity and quality of groundwater and direction of groundwater flow, the patterns of precipitation in the region, and the proximity of residual petroleum to surface waters.	⊠ Yes □ No

Will the requisite level of water quality be met within a reasonable time?  Although WQOs may not have been met at the Site, the approximate time period in which the requisite level of water quality will be met for constituents of concern is decades to hundreds of years. This is a reasonable period in which to meet the requisite level of water quality because current and future beneficial uses are not impaired. Impacted groundwater is not currently being used as a source of drinking water and it is highly unlikely that impacted groundwater will be used as a source of drinking water in the future. Residential and commercial water users are currently connected to the municipal drinking water supply. Public supply wells are constructed with competent sanitary seals and intake screens that are in deeper more protected aquifers. The site conditions do not represent a substantial threat to human health, safety, or the environment, and case closure is appropriate.	lYes □ No
---	-----------

## ATTACHMENT 2: SUMMARY OF BASIC INFORMATION (Conceptual Site Model)

## Site Location/ History

- Location: The Site is located approximately 100 feet west of the intersection of Caspian Avenue and West Esther Street in Long Beach, California. The Site is currently used as an artist's studio and small engine repair and storage. The Site was formally used as a dry cleaning facility, a fiberglass boat manufacturing facility, and an industrial tube cleaning facility. The USTs were removed prior to the current use of the Site.
- The Site is bounded by commercial businesses to the west, east, north, and south.
- Nature of Contaminants of Concern: Petroleum constituents and chlorinated solvents.
- Primary Source of Release: UST system.
- Discovery Date: 2000.
- Release Type: Petroleum<sup>1</sup>; potential minor chlorinated solvents.
- Free Product: Not reported.

#### Table A: USTs

Tank	Size in Gallons	Contents	Status	Date
1 UST	1,000	Gasoline or Solvent	Removed	1973 to 1998
1 UST	550	Gasoline or Solvent	Removed	1973 to 1998
1 UST	280	Gasoline or Solvent	Removed	1973 to 1998
1 UST	280	Gasoline or Solvent	Removed	1973

## Receptors

- Groundwater Basin: Coastal Plain of Los Angeles Groundwater Basin (West Coast subbasin).
- Groundwater Beneficial Uses: Municipal and domestic supply (MUN), agricultural supply (AGR), industrial supply (IND), and industrial process supply (PRO).
- Designated Land Use: Commercial.
- Public Water System: City of Long Beach.
- Distance to Nearest Supply Wells: No supply wells exist within 1,000 feet of the Site.
- Distance to Nearest Surface Waters: Los Angeles River is located greater than 1,000 feet to the east.

## **Geology/ Hydrogeology**

- Average Groundwater Depth: ~ 14 to 25 feet bgs.
- Minimum Groundwater Depth: ~ 14 feet.
- Geology: The Site overlies alluvial deposits consisting primarily of sand, silty sand, and silt from surface to between 18 and 25 feet bgs. Silty clay underlies the sand and silty sand deposits to a maximum depth explored of 35 feet bgs.
- Hydrogeology: Groundwater beneath the Site is unconfined between 25 and 30 feet bgs. Perched groundwater may also exist at the Site at approximately 14 feet bgs. Groundwater flows to the southeast.

<sup>&</sup>lt;sup>1</sup> "Petroleum" means crude oil, or any fraction thereof, which is liquid at standard conditions of temperature and pressure, which means at 60 degrees Fahrenheit and 14.7 pounds per square inch absolute. (Health & Safety Code, § 25299.2)

## **Corrective Actions**

 Three to four USTs removed from the Site between 1973 and 1998. Tank pits were reported to be back filled with concrete.

Table B: Concentrations of Petroleum Constituents in Soil

Sample ID	Date	Depth	TPHd	TPHg	Benzene	Toluene	Ethylbenzene	Xylenes	MTBE
		(ft)	(mg/kg)	(mg/kg)	(mg/kg)	(mg/kg)	(mg/kg)	(mg/kg)	(mg/kg)
Screening Le	vels								
LA Regio	on 4 Screening	Levels	100	100	0.011	0.45	2.0	5.3	0.013
	irect Contact)				1.9		21		
Policy (Di	rect Contact) (	(5 to 10')			2.8		32		
Soil Sample	Results								
GB1-5'	4/10/2000	5	<1.0	<1.0	<0.005	< 0.005	< 0.005	<0.015	<5.0
GB1-10'	4/10/2000	10	<1.0	<1.0	0.035	<0.005	0.0081	0.017	<5.0
GB1-15'	4/10/2000	15	<1.0	60	0.124	0.158	0.856	0.866	<5.0
GB1-20'	4/10/2000	20	<1.0	830	5.23	27.9	9.5	55	<5.0
GB1-25'	4/10/2000	25	<1.0	18	0.811	0.466	0.205	0.693	<5.0
GB1-30'	4/10/2000	30	<1.0	<1.0	0.196	0.093	0.038	0.124	<5.0
GB2-5'	4/10/2000	5	<1.0	<1.0	< 0.005	< 0.005	< 0.005	<0.015	<5.0
GB2-10'	4/10/2000	10	<1.0	237	0.523	2.04	1.39	6.07	<5.0
GB2-15'	4/10/2000	15	<1.0	525	5.6	13.1	5.07	26.4	<5.0
GB2-20'	4/10/2000	20	<1.0	18	0.294	0.0363	0.175	0.616	<5.0
GB2-25'	4/10/2000	25	<1.0	<1.0	0.098	<0.005	0.0069	0.0161	<5.0
GB2-30'	4/10/2000	30	<1.0	<1.0	<0.005	<0.005	<0.005	<0.015	<5.0
GB2-35'	4/10/2000	35	<1.0	<1.0	<0.005	<0.005	<0.005	<0.015	<5.0
GB3-5'	4/10/2000	5	<1.0	<1.0	< 0.005	< 0.005	< 0.005	<0.015	<5.0
GB3-10'	4/10/2000	10	<1.0	<1.0	<0.005	<0.005	<0.005	<0.015	<5.0
GB3-15'	4/10/2000	15	<1.0	16	0.334	0.0577	0.101	1.05	<5.0
GB3-20'	4/10/2000	20	<1.0	35	0.712	0.162	0.35	1.71	<5.0
GB3-25'	4/10/2000	25	<1.0	<1.0	0.24	<0.005	0.029	0.016	<5.0
GB3-30'	4/10/2000	30	<1.0	<1.0	<0.005	<0.005	<0.005	<0.015	<5.0
EI1-S1	6/13/2012	13	<15	14	<0.0016	0.00054	<0.0016	<0.0031	<0.0023
El1-S2	6/13/2012	19	<15	8.2	1.9	0.25	0.39	0.68	<0.083
El2-S1	6/13/2012	11	<5.0	<0.29	<0.0015	<0.0015	<0.0015	<0.003	<0.0022
El2-S2	6/13/2012	19	<15	190	3.2	5.3	5.9	22.8	<0.0022
El3-S1	6/13/2012	13	<5.0	0.64	<0.0015	<0.0015	<0.0015	<0.0029	<0.0022
El3-S2	6/13/2012	18	<15	27	0.074	<0.079	2.0	3.57	<0.079
El4-S1	6/14/2012	6	<5.0	<0.31	<0.0016	<0.0016	<0.0016	<0.0032	<0.0024
El4-S2	6/14/2012	9	<5.0	<0.27	<0.0014	<0.0014	<0.0016	<0.0028	<0.0021
EI4-S3	6/14/2012	13	<5.0	<0.29	<0.0015	<0.0015	<0.0015	<0.0029	<0.0021
El5-S1	6/14/2012	3	<5.0	< 0.33	<0.0015	<0.0015	<0.0015	<0.003	<0.0023
El5-S2	6/14/2012	7	<5.0	<0.28	<0.0014	<0.0014	<0.0014	<0.0028	<0.0021
El5-S3	6/14/2012	11	<5.0	<0.29	<0.0016	<0.0016	<0.0016	<0.0031	<0.0023
Notes:				.5.20					3.0020
	etroleum hydro	carbons as d	iesel						
	etroleum hydro								
	roleum hydroc								
(ylenes - total									
•	I tert-butyl eth	er							
	ams per kilogra								
			n 4 Screening Le	evels					
	esult is below l			7010					
				ter Quality Cont	rol Board UST Cl	nsure Criteria d	ated 2006		
Silt Soil & GV		LOS Alige	loo regional wa	Lor Quality Colli	ISI BOAIG OOT OI	Journal Official C	2000.		
		ces Control P	oard Low-Throat	Underground St	orge Tank Case	Closure Policy			
Resolution No		Jos Contion D	Jaia Low IIIIbat	onadigiound of	orgo rank oase	Ciccuit i oney			
INC	0 00 10)								

Table C. Concentrations of Selected Volatile Organic Compounds in Soil

			Isopropyl-		1,2-	cis-1,2-	N-	1,2,4-	1,3,5-
Sample ID	Date	Depth	benzene	Napthalene	Dichloroethane	Dichloroethene	Propylbenzene	Trimethylbenzene	Trimethylbenzen
		(ft)	(mg/kg)	(mg/kg)	(mg/kg)	(mg/kg)	(mg/kg)	(mg/kg)	(mg/kg)
reening Level									
LA Region 4				3.6	0.0045 <sup>1</sup>	0.19 <sup>1</sup>	3,400	62	780
Policy (Direc				9.7					
Policy (Direct	t Contact) (	(5 to 10')		9.7					
il Sample Res	sults								
	1/10/2000	5							
	1/10/2000	10							
***************************************	1/10/2000	15							
	1/10/2000	20	< 0.005	2.22	<0.05	<0.05	27.1	31.5	9.75
***************************************	1/10/2000	25							
	1/10/2000	30							-
***************************************	1/10/2000	5							
	1/10/2000	10							
	1/10/2000	15	<0.005	0.824	<0.05	< 0.05	6.5	11.6	3.78
	1/10/2000	20							
	1/10/2000	25							
	1/10/2000	30							
	1/10/2000	35							
·····	1/10/2000	5							
	1/10/2000	10							
	1/10/2000	15							
	1/10/2000	20							
	1/10/2000	25							
	1/10/2000	30							
~~~~~~	5/13/2012	13	0.0028	0.0098	<0.0016	<0.0016	0.016	<0.0039	<0.0016
	6/13/2012 6/13/2012	19	0.035	0.14	<0.083	<0.083	0.13	0.41	0.094
·····	5/13/2012 5/13/2012	11 19	0.0012 0.4	<0.0037 0.8	<0.0015 < <b>0.083</b>	<0.0015 <0.083	<0.0015 1.8	<0.0037 13	<0.0015 4.0
	6/13/2012	13	0.0011	<0.0037	<0.003	<0.003	<0.0015	<0.0037	<0.0015
	6/13/2012	18	0.0011	0.67	<0.079	<0.079	0.51	4.3	0.98
	6/14/2012	6	<0.0016	<0.004	<0.0016	<0.0016	<0.0016	<0.004	<0.0016
***********************************	6/14/2012	9	<0.0016	<0.004	<0.0016	<0.0014	<0.0016	<0.004	<0.0016
	5/14/2012	13	<0.0014	<0.0037	<0.0014	<0.0014	<0.0014	<0.0037	<0.0014
	5/14/2012	3	<0.0015	<0.004	<0.0015	<0.0015	<0.0015	<0.0038	<0.0015
	5/14/2012	7	<0.0013	<0.0035	<0.0013	<0.0013	<0.0013	<0.0035	<0.0013
	5/14/2012	11	<0.0016	< 0.0039	<0.002	<0.002	<0.0016	<0.0039	<0.0011
tes:	3/ 1 1/ LO 1 L		40.0010	40.0000	10.00Z	10.00Z	40.0010	40.0000	10.0010
/kg - milligrams	s ner kiloar:	am							
· identifies resul			orting limit						
not analyzed	it is below I	laboratory lep	orang mini						
ld - identifies re	esult is abo	ve I A Region	4 Screening L	evels					
					ontrol Board UST	Closure Criteria	dated 2006 (Silt 9	Soil & GW <20 feet)	
								July 2011 (20 1061)	
San Francisco	Bay Regio	nal Water Qu	ality Control B	oard Environm	ontrol Board UST ental Screening L I Storge Tank Cas	evel for soil.	,	,	

**Table D. Concentrations of Constituents in Groundwater** 

Sample ID	Date	DTW <sup>1</sup>	TPHd	TPHq	Benzene	Toluene	Ethylbenzene	Xylenes	MTBE	1,2-	cis-1,2-DCE	Naphthalene	1,2,4-TMB	1,3,5-TMB
Sample ID	Date		-				-			Dichloroethane		-		
		(ft)	(µg/L)	(µg/L)	(µg/L)	(µg/L)	(µg/L)	(µg/L)	(µg/L)	(µg/L)	(µg/L)	(µg/L)	(µg/L)	(µg/L)
Groundwate	r grab sample	results												
GB1-GW	4/10/2000	27 (15)	<200	58,000	19,400	6,760	1,330	5,510	<1.0	57	<0.4	170	1,150	370
GB2-GW	4/10/2000	27 (10)	<200	8,800	4,000	<0.8	241	<1.0	<1.0	14	14	<1.4	<0.9	<0.7
GB3-GW	4/10/2000	25 (15)	<200	17,300	2.030	47	335	128	<1.0					
EI4-GW	6/14/2012	14	96	200	<0.50	<0.50	<0.50	<2.0	<0.50	<2.0	<2.0	<5.0	<2.0	<2.0
EI5-GW	6/14/2012	14	<470	<50	<0.50	<0.50	<0.50	<2.0	<5.0	<2.0	<2.0	<5.0	<5.0	<2.0
WQO			-	_	1.0	150	300	1,750	13.0	0.5	6.0	0.14	330*	330*
Castle Car	Wash Grou	ndwater	Sample	Results	(Adjacen	t Proper	ty)							
Well ID	Date <sup>2</sup>	DTW	TPHd	TPHg	Benzene	Toluene	Ethylbenzene	Xylenes	MTBE					
		(ft)	(µg/L)	(µg/L)	(µg/L)	(µg/L)	(µg/L)	(µg/L)	(µg/L)					
	Dec-1993	-		7,840	620	210	<50	680						
MW-1 (B4)	Oct-1996			13,000	1,700	1,200	240	640	130					
	Jan-1998	31.0		740	45.1	ND	ND	ND	ND					
	Dec-1993			5,670	400	1,090	<50	570						
MW-2 (B2)	Oct-1996			400	76	1.1	2.6	0.6	5.2					
	Jan-1998	30.9		350	22.1	ND	ND	ND	ND					
	Dec-1993			32,670	3,050	5,460	<50	6,070						
MW-3 (B3)	Oct-1996			1,400	82	4.2	4.5	3.7	9.9					
	1/29/1998	29.7		1,050	228	ND	ND	ND	ND					
	Dec-1993			11,330	410	800	<50	630						
MW-4 (B1)	Oct-1996	_		1,400	200	15	5.3	7.5	11					
	Jan-1998	30.8		220	38.5	ND	ND	ND	ND					
WQO				-	1.0	150	300	1,750	13.0					
Notes:														
DTW - depth t	to water				'<' - identifi	es result is	below laborator	ry reporting	limit					
TPHd - total petroleum hydrocarbons as diesel				ND - sample result reported as non-detect; laboratory reporting limit unknown										
TPHg - total petroleum hydrocarbons as gasoline			<b>bold</b> - identifies that result exceeds WQO											
Xylenes - total xylenes MTBE - methyl tert-butyl ether				DTW for GB1 through GB3 show first water (15) in addition to static water level observed during drilling     WQO - Water Quality Objective - Los Angeles Regional Water Quality Control Board.										
		er						Angeles R	egional Wa	ter Quality Control	Board.			
DCE - dichlore						2- exact sampling date unknown								
TMB - Trimethylbenzene  µg/L - micrograms per liter				Only selected volatile organic compounds that exceed WQO are shown.  * - Department of Public Health Notification Level										
	ble/not analyze	4			ft - feet	TOTAL OF THUL	no ricalti Notili	Janon Leve	•					

#### **Groundwater Trends**

Table D above shows groundwater concentrations for both the Site and for the adjacent off-site Castle Car Wash facility. Groundwater data is limited for the Site; however, groundwater concentration trends for the Site's plume can be inferred with the Castle Car Wash data. Table D show decreasing concentrations for all groundwater monitoring wells located at the Castle Car Wash facility.

#### **Evaluation of Risk Criteria**


- Maximum Petroleum Constituent Plume Length above WQOs: The groundwater plume is less than 250 feet in length.
- Petroleum Constituent Plume Determined Stable or Decreasing: Yes
- Soil/Groundwater Sampled for MTBE: Yes, see Table D above
- Residual Petroleum Constituents Pose Significant Risk to the Environment: No
- Residual Petroleum Constituents Pose Significant Vapor Intrusion Risk to Human Health:
   No Petroleum constituents most likely to pose a threat for vapor intrusion were removed
   during tank removal. Recent petroleum constituent concentrations in soil are significantly lower
   than 2000 samples. Additionally, petroleum constituents in the upper ten feet of soil are minimal
   to non-detect. Shallow groundwater appears to be approximately 25 to 30 feet bgs, thus
   volatiles in groundwater will have little chance to get to surface through the large bioattenuation

zone. Site conditions demonstrate that the residual petroleum constituents in soil and groundwater are protective of human health.

- Residual Petroleum Constituents Pose a Nuisance<sup>2</sup> at the Site: No
- Residual Petroleum Constituents in Soil Pose Significant Risk of Adversely Affecting Human Health: No – The shallow soil has minimal residual contamination.
- Residual Petroleum Constituents Pose Significant Direct Contact and Outdoor Air Exposure to Human Health: No Petroleum constituents appear to be only present between 15 and 25 feet bgs and concentrations for recent samples are below the Commercial/Industrial limits provided in Table 1 of the Policy. There are limited soil samples results in the case record for naphthalene. However, the relative concentration of naphthalene in soil can be conservatively estimated using the published relative concentrations of naphthalene and benzene in gasoline. Taken from Potter and Simmons (1998), gasoline mixtures contain approximately 2% benzene and 0.25% naphthalene. Therefore, benzene concentrations can be used as a surrogate for naphthalene concentrations with a safety factor of eight. Benzene concentrations from the Site are below the naphthalene thresholds in Table 1 of the Policy. Therefore, estimated naphthalene concentrations meet the thresholds in Table 1 and the Policy criteria for direct contact with a safety factor of eight. It is highly unlikely that naphthalene concentrations in the soil, if any, exceed the threshold.
- Residual Chlorinated Solvents in Soil Pose Significant Direct Contact and Outdoor Air Exposure
  to Human Health: No Soil data does not indicate chlorinated solvent constituents in soil at
  concentration that may indicate a health concern.
- Chlorinated Solvents in Groundwater Pose Risk to Human Health: No Only one grab groundwater sample contained cis-1,2-DCE at a concentration that slightly exceeded WQOs. This sample was collected in 2000; it is likely this concentration has reduced through natural attenuation at the Site.
- Chlorinated Solvents Pose Significant Vapor Intrusion Risk to Human Health: No The
  concentration of cis-1,2-DCE is two orders of magnitude lower than San Francisco Bay
  Regional Water Quality Control Board Environmental Screening Levels for Vapor Intrusion to
  Indoor Air from groundwater and soil.

\_

<sup>&</sup>lt;sup>2</sup> Nuisance as defined in California Water Code, section 13050, subdivision (m).

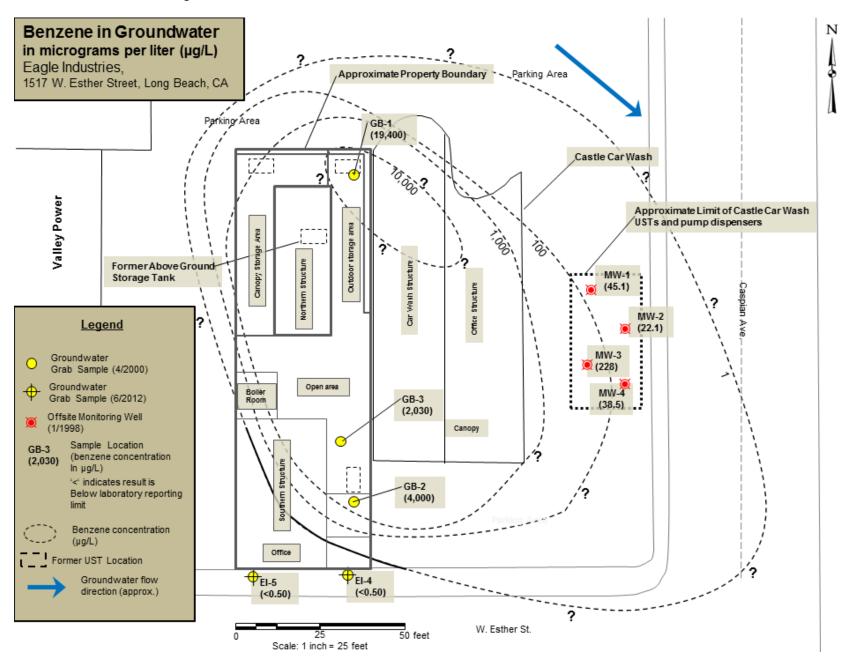

Page 11 of 11